

Site: Land off Cowdale Road, Harper Hill, Buxton
 Surveyed by: Hugh Williams
 Date: 16/03/2026

Tree Heritage Ltd, Unit 1 Sneyd Mill, Sneyd St, Leek, Staffs, ST13 5HP
 T: 01538 384019 E: info@treeheritage.co.uk



APPENDIX A: TREE SURVEY SCHEDULE

KEY:

Measurements	Life Stage	Physiological Condition	Category Grading	Symbols
Height - Metres Stem Diameter - Millimetres at 1.5m above ground level Branch Spread - Metres (North, South, East and West) Crown Clearance - Metres RPA Radius - Metres Estimated Remaining Contribution - Years FSB - First Significant Branch - Metres	Y - Young SM - Semi-Mature EM - Early Mature M - Mature OM - Over-Mature V - Veteran	G - Good F - Fair P - Poor D - Dead	A - High (green) B - Moderate (blue) C - Low (grey) U - Poor/Trees for removal (red) Sub-Categories: 1 - Mainly Arboricultural value 2 - Mainly Landscape value 3 - Mainly Cultural value	< - Less than ~ - Approximately > - Greater than
RPA - Root protection area (equivalent to a circle with a radius 12x the stem diameter measured at 1.5m above ground level)				

Site: Land off Cowdale Road, Harper Hill, Buxton
 Surveyed by: Hugh Williams
 Date: 16/03/2026

Tree Heritage Ltd, Unit 1 Sneyd Mill, Sneyd St, Leek, Staffs, ST13 5HP
 T: 01538 384019 E: info@treeheritage.co.uk

Tree Ref.	Species	Height	Stem Diameter	Branch Spread				Crown Clearance	FSB Height + Direction	Life Stage	Phys. Condition	Structural Condition	Recommendations	Estimated Remaining Contribution	Category Grading	RPA Radius
				N	S	E	W									
T1	Acer pseudoplatanus (Sycamore)	18	860	8	6	7	7	3	3(E)	M	Good	Surface roots sustained bark damage. Damage to buttress roots. Major deadwood in crown. Access for cattle under tree with compaction of soil on East Side and main road to West.	Remove major deadwood over site.	40+	A1	10.32
T2	Acer pseudoplatanus (Sycamore)	17	680	5	6	7	6	3	3(E)	M	Good	Hanging branch/es in crown. Broken branch/es in crown. Major deadwood in crown. Compaction of soil due to cattle access track.	Remove hanging branch/es. Remove major deadwood over site.	20+	B1	8.16
T3	Fagus sylvatica (Beech)	17	720	7	6	7	6	3	3(E)	M	Good	Hanging branch/es in crown. Broken branch/es in crown. Major deadwood in crown. Compaction of soil due to cattle access track.	Remove hanging branch/es. Remove major deadwood over site.	40+	A1	8.64

Site: Land off Cowdale Road, Harper Hill, Buxton
 Surveyed by: Hugh Williams
 Date: 16/03/2026

Tree Heritage Ltd, Unit 1 Sneyd Mill, Sneyd St, Leek, Staffs, ST13 5HP
 T: 01538 384019 E: info@treeheritage.co.uk

Tree Ref.	Species	Height	Stem Diameter	Branch Spread				Crown Clearance	FSB Height + Direction	Life Stage	Phys. Condition	Structural Condition	Recommendations	Estimated Remaining Contribution	Category Grading	RPA Radius
				N	S	E	W									
T4	Ulmus glabra (Wych Elm)	17	660	5	6	7	6	3	3(E)	M	Good	Decay present in stem. Hanging branch/es in crown. Broken branch/es in crown. Major deadwood in crown. Compaction of soil due to cattle access track.	Remove hanging branch/es. Remove major deadwood over site.	20+	B1	7.92
T5	Acer pseudoplatanus (Sycamore)	19	790	8	5	7	6	3	3(E)	M	Good	Hanging branch/es in crown. Broken branch/es in crown. Major deadwood in crown. Compaction of soil due to cattle access track.	Remove hanging branch/es. Remove major deadwood over site.	20+	A1	9.48
T6	Fraxinus excelsior (Ash)	17	770	5	6	7	6	3	3(E)	M	Fair	Decay present in stem. Broken branch/es in crown. Major deadwood in crown. Presence of Chalara Dieback of Ash. Compaction of soil due to cattle access track.	Remove major deadwood over site.	10+	C1	9.24

Site: Land off Cowdale Road, Harper Hill, Buxton
 Surveyed by: Hugh Williams
 Date: 16/03/2026

Tree Heritage Ltd, Unit 1 Sneyd Mill, Sneyd St, Leek, Staffs, ST13 5HP
 T: 01538 384019 E: info@treeheritage.co.uk

Tree Ref.	Species	Height	Stem Diameter	Branch Spread				Crown Clearance	FSB Height + Direction	Life Stage	Phys. Condition	Structural Condition	Recommendations	Estimated Remaining Contribution	Category Grading	RPA Radius
				N	S	E	W									
T7	Fagus sylvatica (Beech)	19	850	8	8	7	8	3	3(E)	M	Good	Included bark present in fork. Hanging branch/es in crown. Broken branch/es in crown. Major deadwood in crown. Compaction of soil due to cattle access track. Break out word in upper crown.	Remove hanging branch/es. Remove major deadwood over site.	40+	A1	10.2
T8	Ulmus glabra (Wych Elm)	19	930	6	8	9	6	2	4(E)	M	Good	Major deadwood in crown.	Remove major deadwood over site.	40+	A1	11.16
T9	Ulmus glabra (Wych Elm)	7	350	7	3	4	5	2	2(N)	EM	Fair	Poor shape/form.	No work required.	10+	C1	4.2
T10	Fraxinus excelsior (Ash)	18	680	5	5	5	5	3	2(N)	M	Poor	Declining. Decay present in stem. Major deadwood in crown. Presence of Chalara Dieback of Ash.	No work required.	<10	U	8.16
T11	Fraxinus excelsior (Ash)	16	640	7	7	5	7	2	2(E)	M	Good	Decay present in stem. Major deadwood in crown. Presence of Chalara Dieback of Ash. Suspected Canker.	No work required.	20+	B1	7.68

Site: Land off Cowdale Road, Harper Hill, Buxton
 Surveyed by: Hugh Williams
 Date: 16/03/2026

Tree Heritage Ltd, Unit 1 Sneyd Mill, Sneyd St, Leek, Staffs, ST13 5HP
 T: 01538 384019 E: info@treeheritage.co.uk

Tree Ref.	Species	Height	Stem Diameter	Branch Spread				Crown Clearance	FSB Height + Direction	Life Stage	Phys. Condition	Structural Condition	Recommendations	Estimated Remaining Contribution	Category Grading	RPA Radius
				N	S	E	W									
T12	Quercus robur (Common Oak)	17	640	5	7	6	6	2	2(W)	M	Good	Broken branch/es in crown. Major deadwood in crown.	Remove major deadwood over site.	20+	B1	7.68
T13	Acer pseudoplatanus (Sycamore)	19	750	9	5	7	9	2	2(N)	M	Good	Broken branch/es in crown. Major deadwood in crown. Crown distorted due to group pressure. Ground trampled by cattle with obvious root damage.	No work required.	40+	A1	9
G1	Acer pseudoplatanus (Sycamore), Fraxinus excelsior (Ash)	5	100	2	2	2	2	1	1(S)	SM	Poor	Stunted habit. Topped trees under power line. Mainly Sycamore.	No work required.	<10	U	1.2