


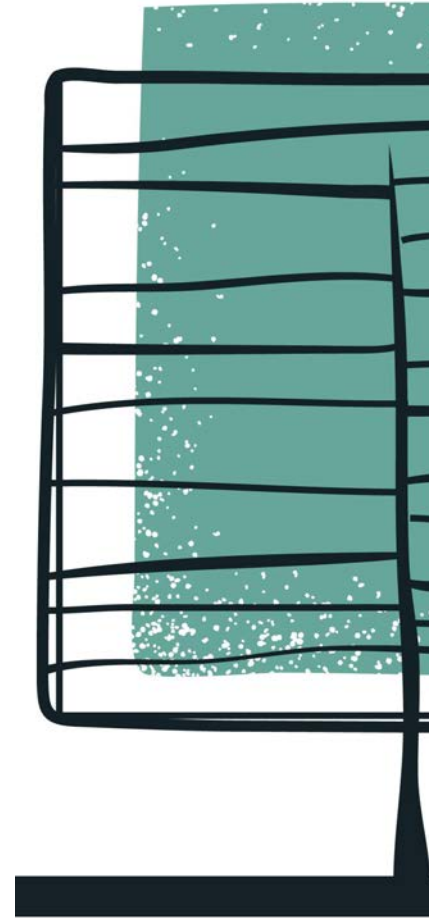

Report No: LTM0187.AIA.01

Date: 24/02/2021

Project: 1a Turnlee Road, Glossop, SK13 6JS

BS 5837:2012 Arboricultural Impact Assessment

Inspection Record.

Date of Inspection	Surveyor
12/02/2021	Matthew Lally. FdSc MArborA

Lally Tree Management.

36 Goldsworthy Road, Urmston, Manchester, M41 8US

[T] 07305 740120 [E] matt@lallytreemanagement.co.uk [W] <https://www.lallytreemanagement.co.uk/>

This report is the property of Lally Tree management. This report may only be reproduced or disclosed to third parties with express written consent from Lally Tree Management.

Revision	Date	Prepared by	Status
Final	24/02/2021	M. Lally	Complete

Contents

Executive Summary	4
1.0 Introduction.....	5
2.0 Planning Policy.	7
3.0 Legislation.....	8
4.0 Survey Methodology.....	9
Veteran and Ancient Trees.....	10
5.0 Development Proposals.....	11
6.0 Impact Assessment.....	12
7.0 Mitigation Proposals.....	12
7.1 Compensatory Planting	12
7.2 Root Pruning.....	13
7.3 Construction of hardstanding within RPA.....	13
7.4 Access Facilitation Pruning.....	14
8.0 Caveats and Limitations	15
Appendix One Tree Survey Data	
Appendix Two Glossary of Terms	
Appendix Three Cascade Chart	
Appendix Four Plans	
Appendix Five Special Surfaces	

Executive Summary

The proposed development site is located along a residential road in Glossop which lies approximately 800metres south of Glossop Town centre. The front aspect of the house sits directly opposite Turnlee Road, the large garden area is located to the east of the current building and borders Long Clough Brook.

Trees, Groups, Hedges, and Woodlands present that could be potentially affected by the development are as follows:

Category A	Category B	Category C	Category U
0	1 Tree 3 Groups 1 Woodland	6 Trees 2 Groups 2 Hedges	0

It is proposed to construct 2 dwellings within the large associated gardens with parking, hardstanding areas and soft landscaping. To facilitate this development, trees requiring removal or other works are as follows:

Tree Category. Trees Requiring Works				
Tree Work Type	Category A	Category B	Category C	Category U
Tree Removal	0	0	4 Trees 2 trees from 1 group 1 Hedge	0
Pruning Works	0	1 Group	0	0
Supervised Root Pruning and Excavation	0	1 Tree	1 Group	
Cellular Confinement System	0	0	1 Group	0

1.0 Introduction

- 1.0.1 The Author of this report is Matthew Lally (MAborA) FdSc. Matthew is a professional member of the Arboricultural Association & The Consulting Arborist Society and is therefore required to uphold ethical standards laid out by these institutions.
- 1.0.2 This Arboricultural Impact Assessment has been commissioned by David Copson of James Lawrence Home Limited and is prepared in relation to the proposed development at 1a Turnlee Road, Glossop, SK13 6JS.

An outline of the site boundary can be found in figure 1.



Figure 1. Assessment Boundary Plan

- 1.0.3 The tree survey & assessment of existing trees has been guided by the recommendations within British Standard 5837:2012 'Trees in Relation to Design, Demolition and Construction - Recommendations'. The recommendations set out a structured assessment methodology to assist in determining which trees would be deemed either as being suitable or unsuitable for retention.
- 1.0.4 British Standard 5837:2012 'Trees in Relation to Design, Demolition and Construction - Recommendations' includes guidance for considering the relationship between existing trees and how to integrate their needs into a successful development. A harmonious and sustainable relationship between any retained trees and new structure and/or hard surfaces is at the heart of the guidance.

- 1.0.5 The survey was carried out on Friday 12 February 2021 by means of inspection from ground level by an experienced and qualified arboriculturalist. The inspection can be restricted in cases where trees were Ivy clad or surrounded by dense vegetation.
- 1.0.6 Due to the size and nature of the site, it was decided that the survey methodology would include broadly grouping trees that share very similar characteristics. This method is in line with point 4.2.4 of BS 5837:2012 that states 'Trees forming groups should be identified and considered as groups where the arboriculturist determines that this is appropriate. It may be appropriate to assess the quality and value of trees as a whole, rather than individuals.'
- 1.0.7 British Standard 5837:2012 recommends the assessment of trees is made as objectively as possible, but the findings will always remain the opinions of the surveyor. The tree categorisation method identifies the quality and value of the existing tree stock, allowing informed decisions to be made concerning development design layout.
- 1.0.8 Table 1 provides a summary of the documents that have been made available by the client:

Table 1 – Documents made available by client.

Document Type	Reference No.	Author	Date
Existing and Proposed Site Plans	DC/01/2020 - 01	NF-PALOMA	OCTOBER 2020

- 1.0.9 The supplied drawing did not include tree positions. Tree positions have been made by eye and by dimensions given by the client, any dimensions regarding tree positions must be checked on site.
- 1.0.10 Weather conditions during the survey were dry and still.
- 1.0.11 Assessing the potential influence of trees upon load bearing soils, beneath existing and proposed structures resulting from water abstraction by trees or rehydration of shrinkable soils was not included in the contract brief and is therefore not considered in the report. The consultant cannot be held responsible for damage arising from such action.
- 1.0.12 Potentially hazardous trees are highlighted, and appropriate recommendations are made. However, this report is not a substitute for a full tree risk assessment or management plan which are specifically designed to minimise risk and liability associated with responsibility for trees.

2.0 Planning Policy.

2.1 National Planning Policy Framework (NPPF)

2.1.1 When determining planning applications, Local Planning Authority's (LPA) should apply the following principles:

- If significant harm to biodiversity resulting from a development cannot be avoided (through locating on an alternate site with less harmful impacts), adequately mitigated, or, as a last resort, compensated for, then planning permission should be refused.
- Development resulting in the loss or deterioration of irreplaceable habitats (such as ancient woodland and ancient or veteran trees) should be refused unless there are wholly exceptional reasons, and a suitable compensation strategy exists.
- Development whose primary objective is to conserve or enhance biodiversity should be supported; while opportunities to incorporate biodiversity improvements in and around developments should be encouraged, especially where this can secure measurable net gains for biodiversity (paragraph 175).

2.1.2. The trees proposed for removal within this report is neither considered aged or veteran and therefore the principles for refusal within the NPPF would not be considered applicable.

2.2 Local Planning Policy High Peak Local Plan Preferred Options.

Policy EQ 8

Trees, woodland and hedgerows

The Council will protect existing trees, woodlands and hedgerows, in particular, ancient woodland, veteran trees and ancient or species-rich hedgerows from loss or deterioration.

This will be achieved by:

- Ensuring that existing woodlands, healthy, mature trees and hedgerows are retained and integrated within a proposed development unless the need for, and benefits of, the development clearly outweigh their loss.
- Requiring new developments where appropriate to provide tree planting and soft landscaping, including the replacement of any trees that are removed.
- Resisting development that would directly or indirectly damage existing mature or ancient woodland, veteran trees and ancient or species-rich hedgerows.

No species rich hedgerows, ancient or veteran trees or ancient woodland are to be removed as part of this development. It is also proposed to replant trees that have been lost in line with High Peaks Planning Policy.

3.0 Legislation

Statutory Considerations

3.0.1 A Tree Preservation Order (TPO) is an order made by a local planning authority to protect specific trees, groups of trees or woodlands in the interests of amenity. A TPO prohibits the:

- cutting down
- topping
- lopping
- uprooting
- willful damage
- willful destruction

of trees without the local planning authority's written consent. If consent is given, it can be subject to conditions which have to be followed. In the Secretary of State's view, cutting roots is also a prohibited activity and requires the authority's consent. Anyone found guilty of such an offence is liable and in serious cases, may result in prosecution and incur an unlimited fine.

3.0.2 It is understood following consultation with the Local Planning Authority's (High Peak Borough Council) Interactive Mapping Service on 16/02/2021 that there are no Tree Preservation Orders or Conservation Area designations that would apply to any trees present within the confines of this site. There is, however, a Conservation Area designation (St James) applied to land to the east and north of the Long Clough Brook as outlined in figure 1.

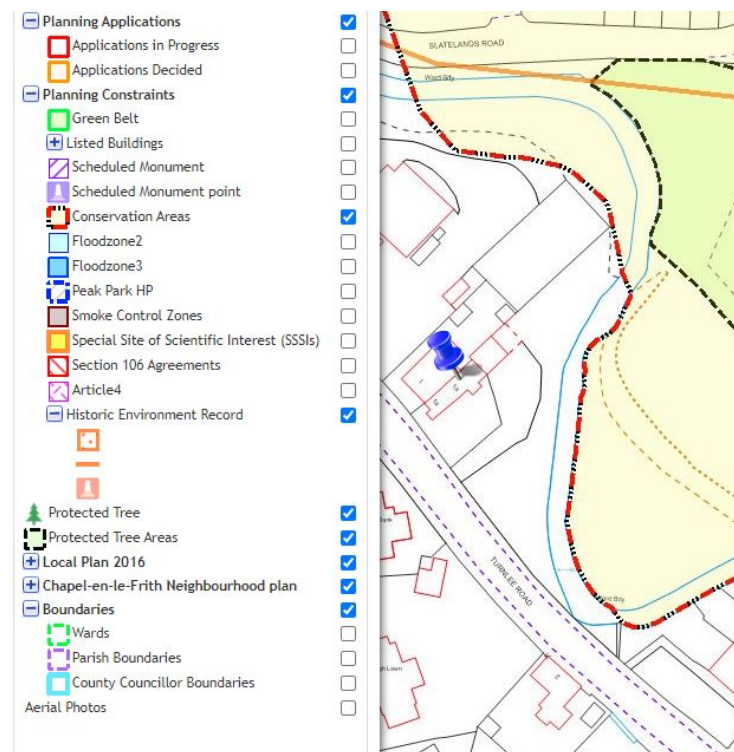


Figure 1: A screen shot of the High Peak Borough Council interactive mapping service showing the locations of any protected trees and of any conservation areas.

3.0.3 Felling Licence

- 3.0.4 Tree felling is also restricted under the Forestry Act 1967. Under this act, there is an exemption from the need for a felling licence for "Felling trees immediately required for the purpose of carrying out development authorised by planning permission (granted under the Town and Country Planning Act 1990) ..."
- 3.0.5 If full planning permission is granted, then any trees which require felling to implement the approved plans are exempt from this statutory protection. Outline planning permission does not provide an exemption to the regulations that control tree felling in the Forestry Act 1967.

4.0 Survey Methodology

- 4.0.1 The trees were surveyed in accordance with Chapter 4 of BS5837:2012. The tree metrics have been recorded in the tree schedule in appendix one. Where groups of trees and woodland groups have been recorded, average height, average crown spread and average diameter at breast height (DBH) are reported. Where access to the base of any trees was limited then measurements were estimated.
- 4.0.2 Trees have been assessed as individual trees (T), groups of trees (G), hedgerows (H) or woodland Groups (W) where it has been determined appropriate.
- The term group has been applied where trees form cohesive arboricultural features either aerodynamically, visually, or culturally.
 - For the purposes of this assessment, a hedgerow is described as any boundary line of trees or shrubs less than 5m wide at the base and are managed or have been managed under a regular pruning regime.
 - For the purposes of this assessment, woodland is described as a habitat where 'trees are the dominant plant form. The individual tree canopies generally overlap and interlink, often forming a more or less continuous canopy'.
- 4.0.3 All the trees were assessed using: a grading A to C (retention) and U (removal); condition and age class as defined in appendix two.
- 4.0.4 Where appropriate, canopy spread for each tree was recorded at four cardinal points in order to reproduce an accurate representation of the crown shape of the tree on the tree plan in appendix four.
- 4.0.5 The survey included all trees within the proposal area and trees near to the proposal.

Veteran and Ancient Trees

4.0.6 Veteran trees and Ancient Woodland are important components of the landscape, their importance can be for a number of reasons including that of their ecological, social, cultural and historic value.

4.0.7 Veteran Trees and Ancient Woodlands are material considerations within the planning process and their importance is specifically recognised within the National Planning Policy Framework (NPPF) 2019

4.0.8 Ancient Tree Guide No4 Published by the Woodland Trust and the Ancient Tree Forum states that:

'An ancient tree is one that has passed beyond maturity and is old, or aged, in comparison with other trees of the same species. Its canopy may be small. It will probably have a very wide trunk relative to other trees of the same species and it is very likely that it will be hollow'

AND

'Veteran is a term describing a tree with habitat features such as wounds or decay. The terms ancient and veteran have been used interchangeably in the past, however, it is important to know what the differences between them [are]. A veteran tree is a survivor that has developed some of the features found on an ancient tree, not necessarily as a consequence of time, but of its life or environment. Ancient veterans are ancient trees, not all veterans are old enough to be ancient. A veteran may be a young tree with a relatively small girth in contrast to an ancient tree but bearing the 'scars' of age such as decay in the trunk, branches or roots, fungal fruiting bodies, or dead wood. These veteran features will still provide wildlife habitat'

4.0.9 Different methodologies are available for the defining of Veteran & Ancient trees in the field. Lally Tree Management use RAVEN (Recognition of Ancient, Veteran and Notable Trees) allowing quick and easy assessments to be made, whilst trying to ensure these valuable assets to our environment do not go un-noticed.

4.0.10 No Veteran Trees or Ancient Trees were identified on this site.

5.0 Development Proposals

5.0.1 Overlaying the development plans & their associated infrastructure over the existing site plans has highlighted a number of areas where trees are in conflict with the proposal. This plan has been made available in appendix four and given the title 'Arboricultural Implications Plan'.

5.0.2 In order to fully assess the impact of the proposals an Impact Table has been created detailing each tree, which shows the proximity of the associated works to the tree.

5.0.3 The aforementioned data and plans are analysed to determine whether the development will have a detrimental impact on the health of each tree. Once this has been determined, remedial measures can be detailed to reduce the impact the proposals will have on the treescape.

5.0.4 Impact Table: -

Tree No.	Root Protection Area identified (m ²) in Table 2 of BS 5837:2012	Distance to Proposed Hard Standing (m)	Distance to Proposed Development (m)	Can the Tree/s be Successfully Retained	Retention Category
T1	20	-	-	No	C1
T2	41	-	-	No	C1
T3	18	-	-	No	C1
G4	52	8.40	9.40	Yes	B2
T5	18	4.80	3.20	Yes	C1
G6	84	4.10	4.60	Yes	B2
G7	15	5.10	6.10	Yes	C2
G8	104	1.40	3.90	2 x Trees to be removed. Remaining trees to be retained as outlined in 7.2 & 7.3	C2
T9	209	4.20	5.60	Yes, as outlined in 7.3	B1
T10	13	-	-	No	C1
T11	7	8.20	9.20	Yes	C1
G12	72	14.00	15.00	Yes	B2
H13	5	1.10	1.70	Yes	C1
H14	4	-	-	No	C1
W15	84	5.60	7.70	Yes	B2

6.0 Impact Assessment

6.1 To assess the implications of the Impact Table each tree can be categorised in the following way: -

	Trees to be Retained		Trees to be Removed	
	With No Impact	With detailed construction	Due to Condition	Due to Development
Category A	-	-	-	-
Category B	G4, G6, G12, W15	T9	-	-
Category C	T5, G7, T11, H13	G8	-	T1, T2, T3, 2x Trees from G8, T10, H14
Category U	-	-	-	-
TOTAL	8	2	0	6

7.0 Mitigation Proposals

7.1 Compensatory Planting

7.1.1 Due to the loss of the trees identified in section 6.1 it is proposed that along with the general soft landscaping for the development, more substantial supplementary tree planting will support the application.

7.1.2 This will have a number of benefits for the development and the character of the area. These being: -

- Give a greater diversity of age class on the site, increasing sustainability.
- Give a greater diversity of species and therefore wildlife habitat.

7.1.3 The trees proposed are listed in the schedule below: -

Tree Species	Tree Size
<i>Acer campestre</i> 'William Caldwell'	12-14 cm girth
<i>Betula pendula</i>	12-14 cm girth
<i>Crataegus crus-galli</i>	12-14 cm girth
<i>Carpinus betulus</i> 'Frans Fontaine'	12-14 cm girth
<i>Sorbus aucuparia</i>	12-14 cm girth
<i>Crataegus laevigata</i> 'Paul's Scarlet'	12-14 cm girth

7.1.4 The extent of mitigation planting required will need to be confirmed in agreement with the Local Planning Authority once the development proposal is finalised. Requirements usually involve replacement of trees on a two for one basis. This is based on tree sizes of 12-14cm girth.

7.2 Root Pruning.

7.2.1 The proposed construction of the buildings encroaches into the RPA of G8 by less than 4.2% & T9 by less than 6.9%

7.2.2 To facilitate the development and prevent damage to any tree roots within the RPAs of these trees, all excavation should be supervised by an Arboricultural Consultant and any root pruning that is required should be undertaken by the Arboricultural Consultant.

7.2.3 If the following points are adhered to then the long-term health and retention of G8 and T9 will not be adversely affected.

- Excavation must be carried out using hand tools to avoid direct damage to the bark of the roots. It may be possible in some instances to use specialised equipment such as high air pressure machinery to excavate the soil with minimal disturbance to roots.
- Exposed roots will be wrapped in moist, clean hessian to prevent the roots from drying out in hot or dry weather. The hessian must be removed before backfilling.
- Roots less than 25mm diameter may be pruned back, preferably to a growing point. A sharp cutting tool such as bypass secateurs or a handsaw should be used to leave the smallest wound possible. Roots greater than 25mm in diameter should be retained wherever possible.
- Root pruning should be carried out under the supervision of the Arboricultural Consultant.
- Backfilling of any excavation must be carried out by hand to avoid direct root damage or compaction, where possible. Builder sand must not be used in the backfill material.

7.3 Construction of hardstanding within RPA

7.3.1 As shown above, the Impact Table raises concern of the proximity of the car parking space adjacent to G8 and the effect the proposals would have on the Safe Useful Life Expectancy of the trees.

7.3.2 Section 7.5.3 of BS 5837:2012 advises that where new hardstanding is to be formed within the RPA it should not exceed 20% of any existing unsurfaced ground. The table below details the amount of encroachment within the RPA.

Tree No	Total Area m2 of RPA	Total m2 of Structure within the RPA	Percentage of Hardstanding within the RPA
G8	104	10.60	10.20

7.3.3 As you can see from the table above the proposed structure does not exceed 20% of the RPA.

7.3.4 If ground levels remain the same, the detrimental effects the parking space would have on this tree would be: -

- Compaction, resulting in oxygen depletion, caused from creating the access way.
- The loss of a permeable surface.

7.3.5 It is now possible with the use of a cellular confinement system to be able to create parking spaces very close to trees without having a detrimental effect.

7.3.6 A cellular confinement system provides a load transfer mattress which prevents direct loads on tree roots and reduces the bearing pressure on subsoil's by stabilising aggregate surfaces against rutting under wheel loads.

7.3.7 A proposed methodology and cross-sectional diagram for the construction of the access way can be found in appendix five of this report. Should this be used for the construction of the parking space in the area effecting G8 then the proposals should not have a detrimental effect on the safe useful life expectancy of the trees.

7.4 Pruning of G6.

7.4.1 To help with the construction of the buildings the reduction of G6 on the development side should be undertaken. The subordination of the branches by up to 2.5m and lifting of the crown to 5m on the development side of the crown will create space for the development to be undertaken without damaging branches of this group


7.4.2 If all pruning works are undertaken in line with British Standard 3998:2010 Tree Work – Recommendations then the Safe Useful Life Expectancy of the trees will not be adversely affected.

8.0 Caveats and Limitations

- 8.1 The report is for the sole use of the client and its reproduction or use by anyone else is forbidden unless written consent is given by the author.
- 8.2 This is an arboricultural report and as such no reliance should be given to comments relating to buildings, engineering, soils ecological or archaeological data. If either is commented upon within the report further professional advice should be sought.
- 8.3 This is not a Tree Risk Assessment. As such this report should not be taken to mean or imply that any of the inspected trees should be considered safe. A Tree Risk Assessment can be provided but would be subject to additional survey requirement and further fees.
- 8.4 Trees are growing dynamic structures. Whilst reasonable effort has been made to identify defects within the trees inspected, no guarantee can be given as to the absolute safety or otherwise of any individual tree. No tree is ever absolutely safe due to the unpredictable laws and forces of nature. As a result of this, natural failure of intact trees will occur; extreme climatic conditions can cause damage to even apparently healthy trees.
- 8.5 For the purposes of this survey all dimensions of trees and their associated parts are based on estimation unless otherwise stated.
- 8.6 Trees are living organisms whose health, condition and structure can change quickly and without warning. Therefore, the contents of this report are valid for a period of one year from the date of this survey.

Appendix One

Tree Survey Data

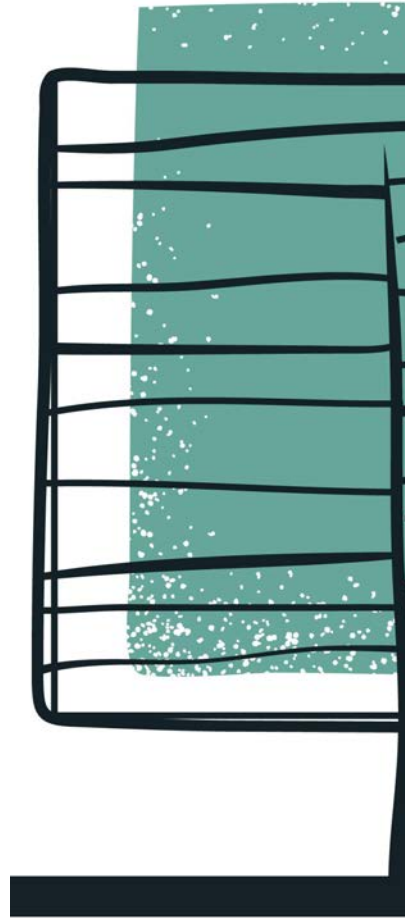

BS5837:2012 TREE SCHEDULE



DATE OF SURVEY: 12/02/2021

JOB REFERENCE: LTM0187.AIA.01

SITE ADDRESS: Turnlee Road

Tree No.	Species	Stem Dia (mm)	RPA (m ²)	RPA Radius (m)	Height (m)	Age Class	Crown Spread (m)				Crown Clearance (m)	Condition	Comments	Recommendations	Remaining Contribution	BS5837 Retention Category
							N	E	S	W						
T1	Gleditsia	210	20	2.52	6	SM	4	3	1	3	2N	B	Asymmetrical crown. Good vitality. Highly visible from public viewpoints. Low arboricultural value.	No action	20+	C1
T2	Norway Maple	300	41	3.6	9	SM	3	3	4	4	2N	A	Good form and vitality. High visibility from public viewpoints. No risk features observed.	No action	40+	C1
T3	Persian Ironwood	200	18	2.4	5	SM	2	1	4	4	2W	A	Co-dominant form. Good vitality. Moderate visibility from public viewpoints. No significant risk features observed.	No action	40+	C1
G4	Ash x 2	340	52	4.08	16	EM	5	5	5	5	6N	B	A group of 2 x Ash. Good vitality. Located on bank adjacent to stream. Acceptable condition.	No action	20+	B2
T5	Sycamore	200	18	2.4	12	SM	3	3	3	3	5N	B	Suppressed tree. Located on bank of brook in close proximity to 1 x tree from G6. Acceptable condition.	No action	40+	C1
G6	Ash x 2	430	84	5.16	17	EM	6	3	5	6	3W	B	Good form and vitality. Located by brook.	No action	40+	B2
G7	Pear x 1. Japanese Maple x 1	180	15	2.16	6	EM	2	2	2	2	0W	A	Good form and vitality. No risk features observed. Located adjacent to brook.	No action	40+	C2
G8	Lawson Cypress Hedge	480	104	5.76	14	EM	4	4	4	4	0N	B	Previously topped. Included unions present. Previous failures throughout group with large areas of xylem exposed.	No action	10+	C2
T9	Alder	680	209	8.16	18	EM	6	6	6	6	4N	B	Large multi-stemmed tree by brook. Acceptable condition.	No action	40+	B1
T10	Laburnham	170	13	2.04	4	SM	2	2.5	2.5	3	3W	B	Minor basal movement. Good vitality. Located in grassed area at rear of property.	No action	20+	C1

BS5837:2012 TREE SCHEDULE



DATE OF SURVEY: 12/02/2021


JOB REFERENCE: LTM0187.AIA.01

SITE ADDRESS: Turnlee Road

Tree No.	Species	Stem Dia (mm)	RPA (m ²)	RPA Radius (m)	Height (m)	Age Class	Crown Spread (m)				Crown Clearance (m)	Condition	Comments	Recommendations	Remaining Contribution	BS5837 Retention Category
							N	E	S	W						
T11	Birch	120	7	1.44	4	SM	3	1	1	2	2N	A	Ornamental tree at rear of property.	No action	40+	C1
G12	Willow, Sycamore, Ash	400	72	4.8	17	EM	5	5	5	5	4W	B	A group of 3 trees on rear boundary. Willow has minor stem decay.	No action	20+	B2
H13	Leyland Cypress	100	5	1.2	4	SM	1	1	1	1	0N	B	Boundary hedge. Low value.	No action	20+	C1
H14	Lawsons Cypress	90	4	1.08	2.5	SM	1	1	1	1	0N	B	A boundary hedge located at front of property. Dead sections on back side. Low arboricultural value. Acceptable condition.	No action	10+	C1
W15	Mixed Broadleaves	430	84	5.16	0 to 20	Y to M	4	4	4	4	0N	A to C	A woodland group located on eastern side of Long Clough Brook. Estimated measurements. Not inspected.	No action	80+	B2

Appendix Two

Glossary of Terms

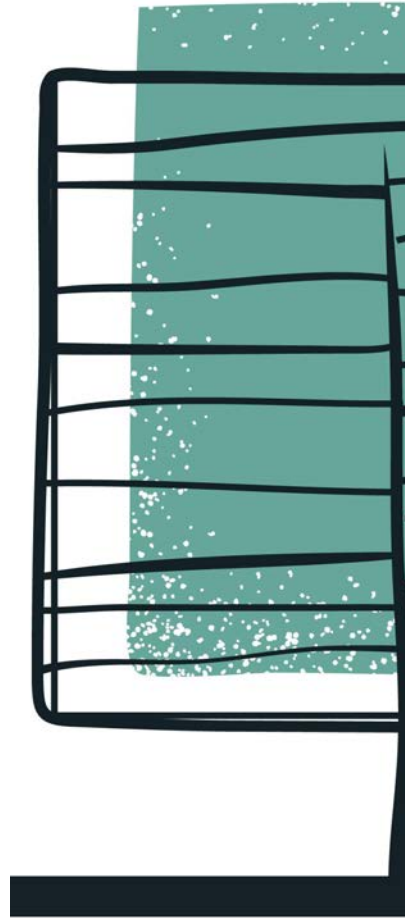

The following terms are concurrent with best Arboricultural practice and within the guidelines set by the International Society of Arboriculture (ISA), the Arboricultural Association (AA) and the British Standards Institute (BSI).

Age Range:

Age is site specific and categorised:

Young (Y)	Out-planted trees that have not yet established.
Semi-Mature (SM)	Established trees up to 1/3 of expected height and crown.
Early Mature (EM)	Between 1/3 and 2/3 of expected height and crown.
Mature (M)	Between 2/3 and full expected height and crown.
Fully Mature (FM)	Full expected height and crown.
Over Mature (OM)	Crown beginning to break-up and decrease in size.
Senescent (S)	Crown in advanced stage of break-up.

Height: Height is estimated and recorded in metres.

DBH: Diameter at Breast Height is measured at 1.5m and recorded in metres. Where a tree becomes multi-stemmed below 1.5m the highest possible diameter is measured and indicated. Alternatively, above 1.5m the diameter of each stem or an average diameter is measured and indicated.

Condition: Assessment of current physiological condition and structural morphology incorporating vigour and vitality and categorised:

- A -** Tree needing little, if any attention
- B -** Tree with minor, but rectifiable defects, or in the early stages of physiological stress
- C -** Tree with significant structural and physiological flaws and/or extremely stressed
- D -** Tree that is dead, biologically/physically moribund or dangerous

Desirability to Retain – As Outlined in Table 1 of BS 5837:2005 (Trees in Relation to Construction - Recommendations)

Definition of Physiological & Morphological Terms

Adaptive Growth - The process whereby wood formation is influenced both in quantity and in quality by the action of gravitational force and mechanical stresses on the cambial zone.

Bifurcation – Forked or divided union.

Brown Rot - Form of decay where cellulose is degraded, while lignin is only modified.

Cankers- A localised area of dead bark and cambium on a stem or branch, caused by fungal or bacterial organisms, characterised by wound wood development on the periphery. This may be annual or perennial.

Cavity - An open wound, characterised by the presence of extensive decay and resulting in a hollow.

Chlorotic Leaf - Lacking in chlorophyll, typically yellow in colour.

Compartmentalisation - The physiological process that creates the chemical and mechanical boundaries that act to limit the spread of disease and decay organisms.

Crack - Longitudinal split in stem or branch, involving bark and/or underlying wood. These may be vertically and horizontally orientated.

Decay - Process of degradation of woody tissues by fungi and bacteria through decomposition of cellulose and lignin.

Deadwood - Deadwood is often present within the crown or on the stems of trees. In some instances, it may be an indication of ill health, however, it may also indicate natural growth processes. If a target is present beneath the tree, deadwood may fall and cause injury or damage and should be removed, otherwise deadwood can remain intact for conservation purposes (insects, fungi, birds etc.).


End Weight -	The concentration of foliage at the distal ends of stems and deficient in secondary branches.
Girdling Root -	Root which circles and constricts the stem or roots causing death of phloem and/or cambial tissue.
Hazard Beam -	An upwardly curved branch in which strong internal stresses may occur without the compensatory formation of extra wood (longitudinal splitting may occur in some cases).
Included Bark Union -	Pattern of development at branch junctions where bark is turned inward rather than pushed out. Potential weakness due to a lack of a woody union.
Ivy Growth -	Ivy growth may ascend into the tree's crown, increasing wind resistance, concealing potential defects and reducing the tree's photosynthetic capacity. Ivy growth is often acceptable in woodland areas as a conservation benefit.
Live Crown Ratio -	The relative proportion of photosynthetic mass (leaf area) to overall tree height.
Reaction Wood -	Specialised secondary xylem, which develops in response to a lean or similar mechanical stress, attempting to restore the stem to the vertical.
Root Plate Lift -	The physical movement of the rooting plate causing soils to shift and crack. May occur during adverse weather conditions. Trees may become unstable.
Structural Defect -	Internal or external points of weakness, which reduce the stability of the tree.
Suppressed -	Trees which are dominated by surrounding vegetation and whose crown development is restricted from above.
Topping -	A highly disfiguring practise, likely to cause severe xylem dysfunction and decay in major structural parts of the wood.

- White Rot -** Form of decay where both cellulose and lignin are degraded.
- Wound -** Any injury, which induces a compartmentalisation response.
- Wound wood -** Wood with atypical anatomical features, formed in the vicinity of a wound and a term to describe the occluding tissues around a wound as opposed to the ambiguous term "callus."
- Woodland Structure -** The vertical and horizontal arrangement of trees within a group or woodland i.e. Dominant - trees with a crown above the upper layer of the canopy, Co-dominant - trees that define the general upper edge of the canopy, Intermediate - trees that have been largely overgrown by others, Suppressed - trees that have been overgrown and occupy an under storey position and grow slowly, often severely asymmetrical.

Note: *The definitions described above, may not necessarily be included within the Arboricultural Survey Data.*

Appendix Three


Cascade Chart

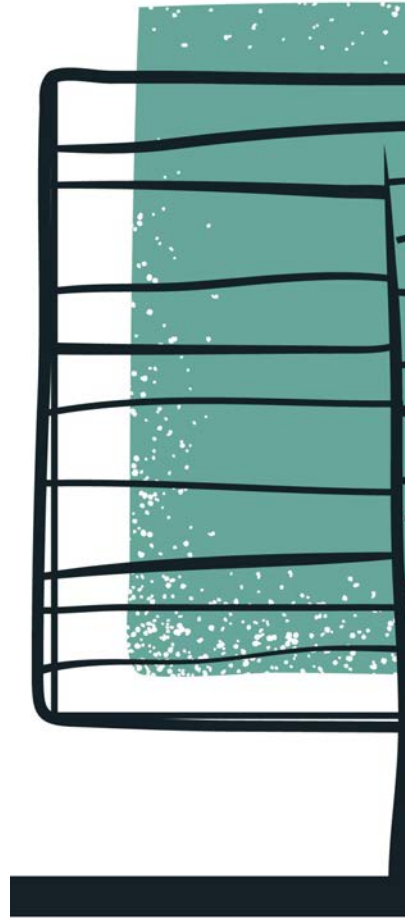


Trees for removal			
Category and definition	Criteria		
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	- o Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other U Category trees (i.e. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning) - o Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline. - o Trees infected with pathogens of significance to the health and/or safety of other trees nearby) e.g. Dutch elm disease), or very low-quality trees suppressing adjacent trees of better quality. NOTE: <i>Category U trees can have existing or potential conservation value which might be desirable to preserve; see section 4.7.5</i>		
Trees to be considered for retention			
Category and definition	Criteria and sub-categories		
	1) Mainly arboricultural values	2) Mainly landscape values	3) Mainly cultural values (including conservation)
Category A Trees of high quality: with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species especially if rare or unusual, or essential components of groups, or of formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and or landscape features	Trees, groups or woodlands of significant conservation, historical commemorative or other value (e.g. veteran trees or wood-pastures)
Category B Those of moderate quality: with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider area	Trees with clearly identifiable conservation or other cultural benefits
Category C Those of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in the higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater landscape value, and/or trees offering low or only temporary screening benefit.	Trees with no material conservation or other cultural value

Appendix Four

Plans

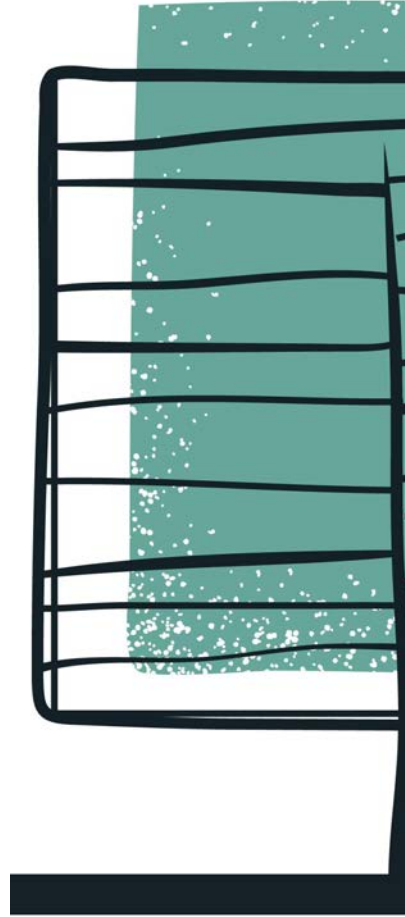

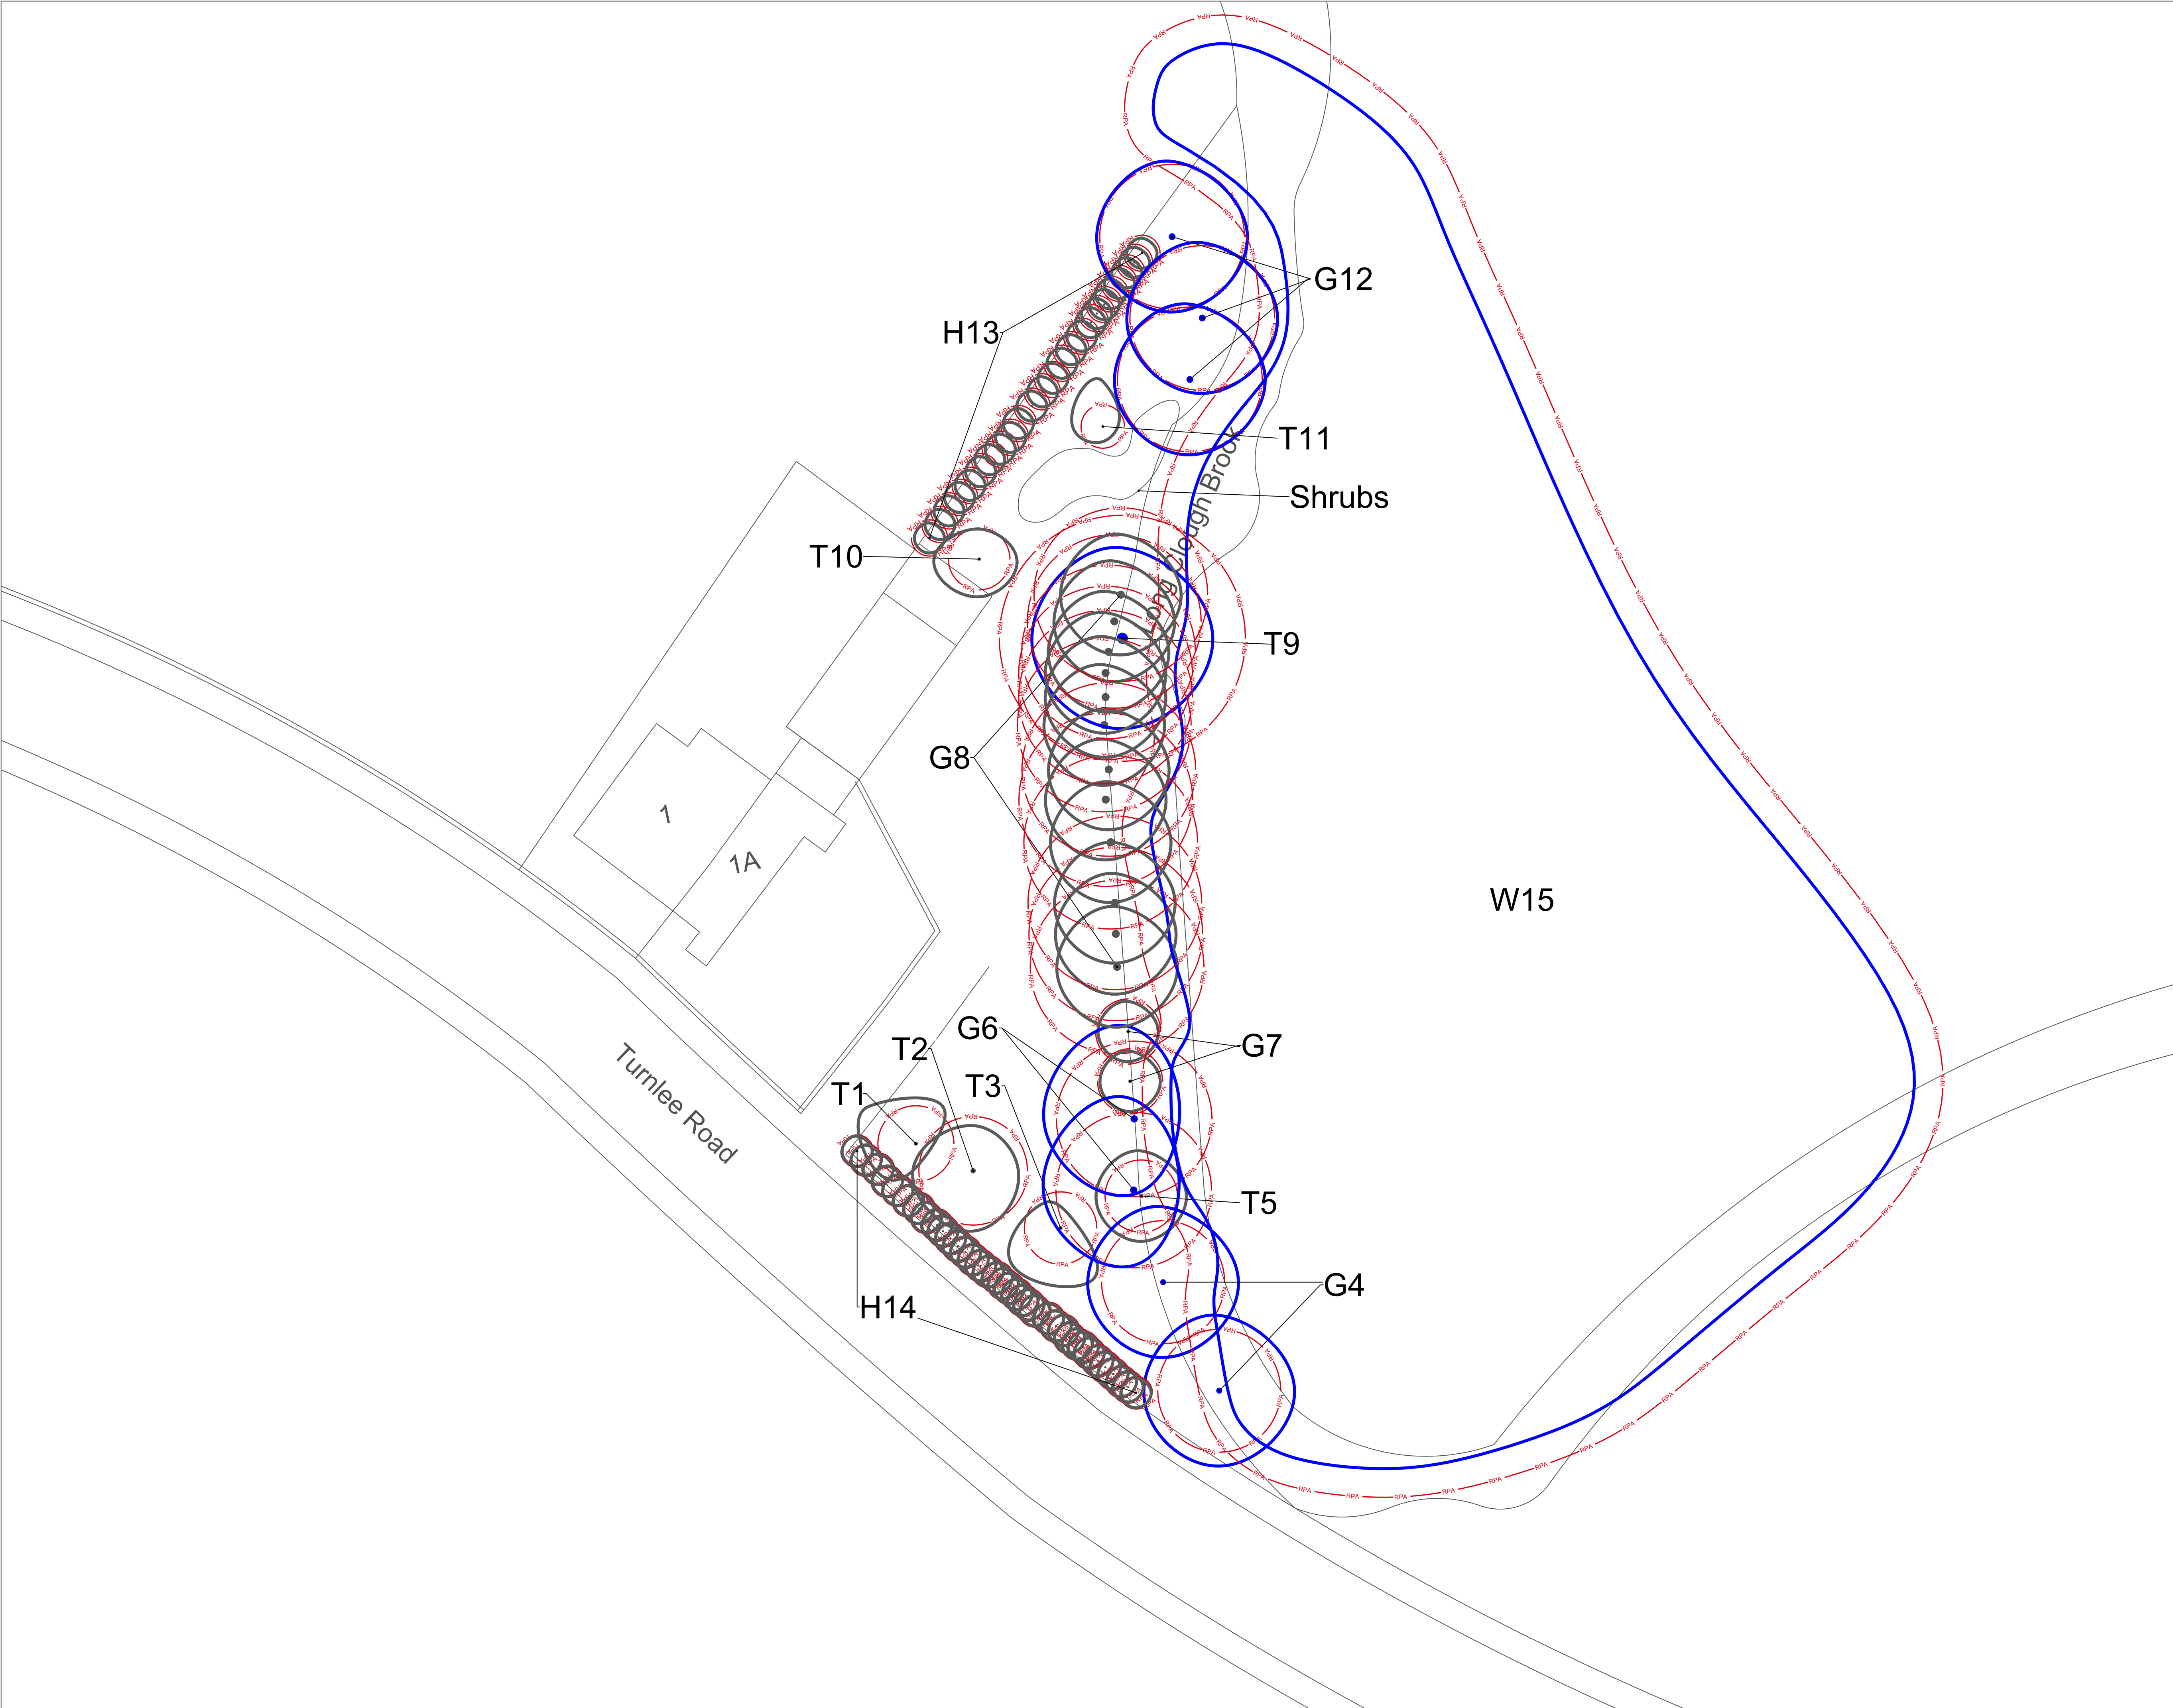

Do not scale this drawing (printed or electronic version).
Contractors must check all dimensions from site.
This drawing is for use on this site only and should be used in conjunction with all relevant consultants drawings.

LEGEND

Category A

Category B

Category C

Category U

Root Protection Area (RPA)

N

Scale:	1:200 @ A1	Date:	15/02/2021
Job:	LTM0187. Turnlee Rd		
Address	1a Turnlee Road, Glossop, SK13 6JS		
Client:	JAMES LAWRENCE HOMES LIMITED		
Drawing Number:	LTM0187.TCP.01		
Drawn by:	Matthew Lally		
TREE CONSTRAINTS PLAN			



Do not scale this drawing (printed or electronic version).
Contractors must check all dimensions from site.
This drawing is for use on this site only and should be used in conjunction with all relevant consultants drawings...

LEGEND

- Category A
- Category B
- Category C
- Category U
- Root Protection Area (RPA)


Lally

TREE MANAGEMENT

Scale:	1:200 @ A1	Date:	15/02/2021
Job:	LTM0187. Turnlee Rd		
Address	1a Turnlee Road, Glossop, SK13 6JS		
Client:	JAMES LAWRENCE HOMES LIMITED		
Drawing Number:	LTM0187.AIP.01		
Drawn by:	Matthew Lally		
Arboreal Implications Plan			

Appendix Five

Special Surfaces

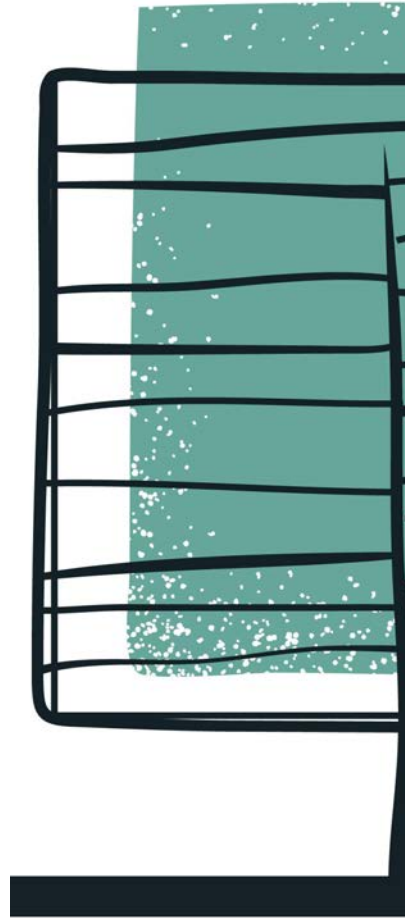

METHODOLOGY FOR THE CONSTRUCTION OF CAR PARKING


The following methodology supports the drawing indicating the construction of the proposed car parking space. The methodology is prepared on the basis of the sequence of operations necessary to complete the construction of the car parking space with the minimum damage to the trees proposed for retention.

- Surface layer to be scraped off. This can be done either by hand or by very small machinery.
- Erect protective fencing to the edge of the construction area.
- Spread a sub grade material over the length of the car parking space to fill any small ruts.
- Construct edging using treated timber if required.
- Lay geotextile mat over smoothed area.
- Extend the Geoweb perforated tree root protection system over the area of the car parking space with sufficient overlap such that kerbs can be constructed on top of the Geoweb.
- Fill the voids within the Geoweb with reduced fines Type 1 material working into the site over the top of the Geoweb.
- Lay kerbs and surface over the Geoweb such that the construction binds itself together.
- Construct finished surface as required in line with guidance illustrations below.


GEOWEB BASED CONSTRUCTION – (INDICATIVE ONLY)

Depth of confinement system variable according to use- refer to manufacturer

Tarmac Surface

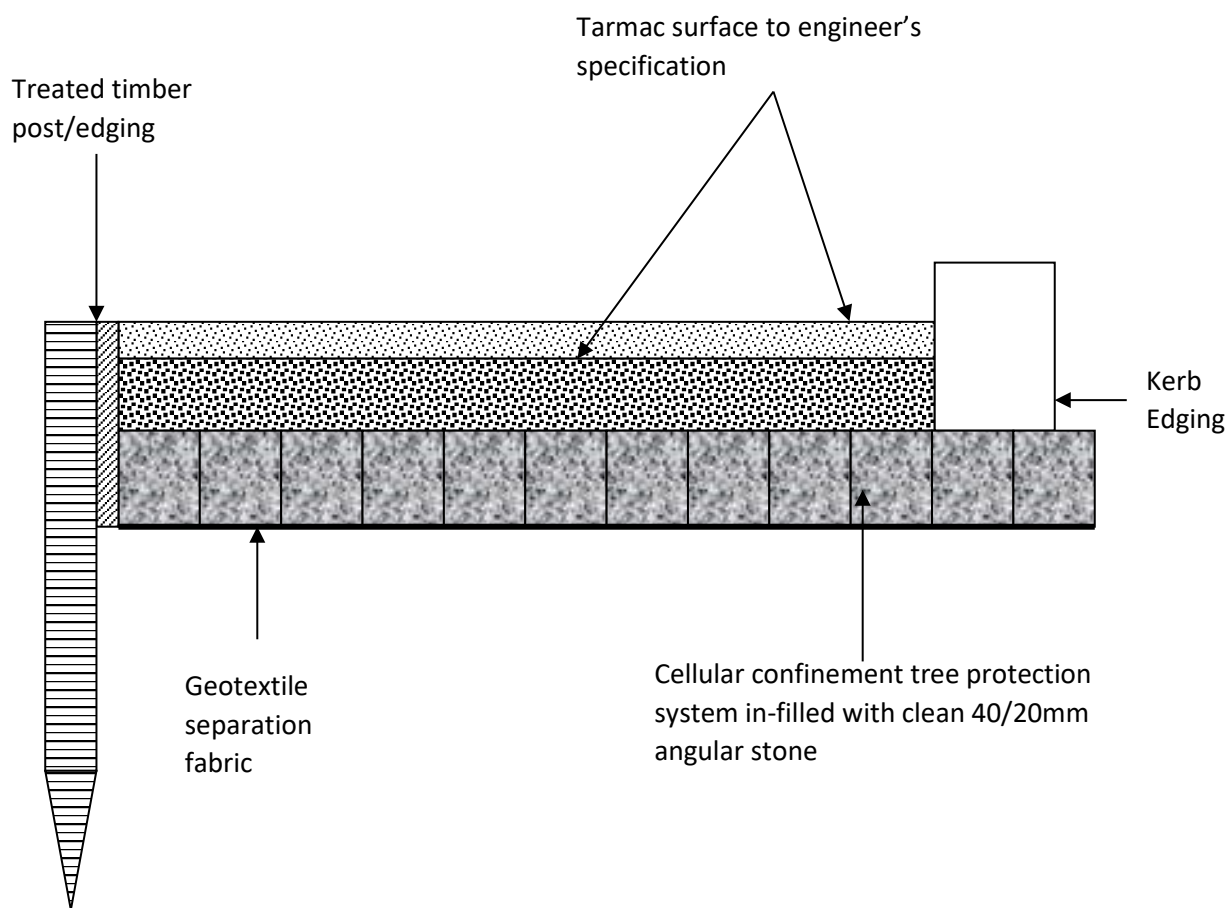

Block Paved Surface

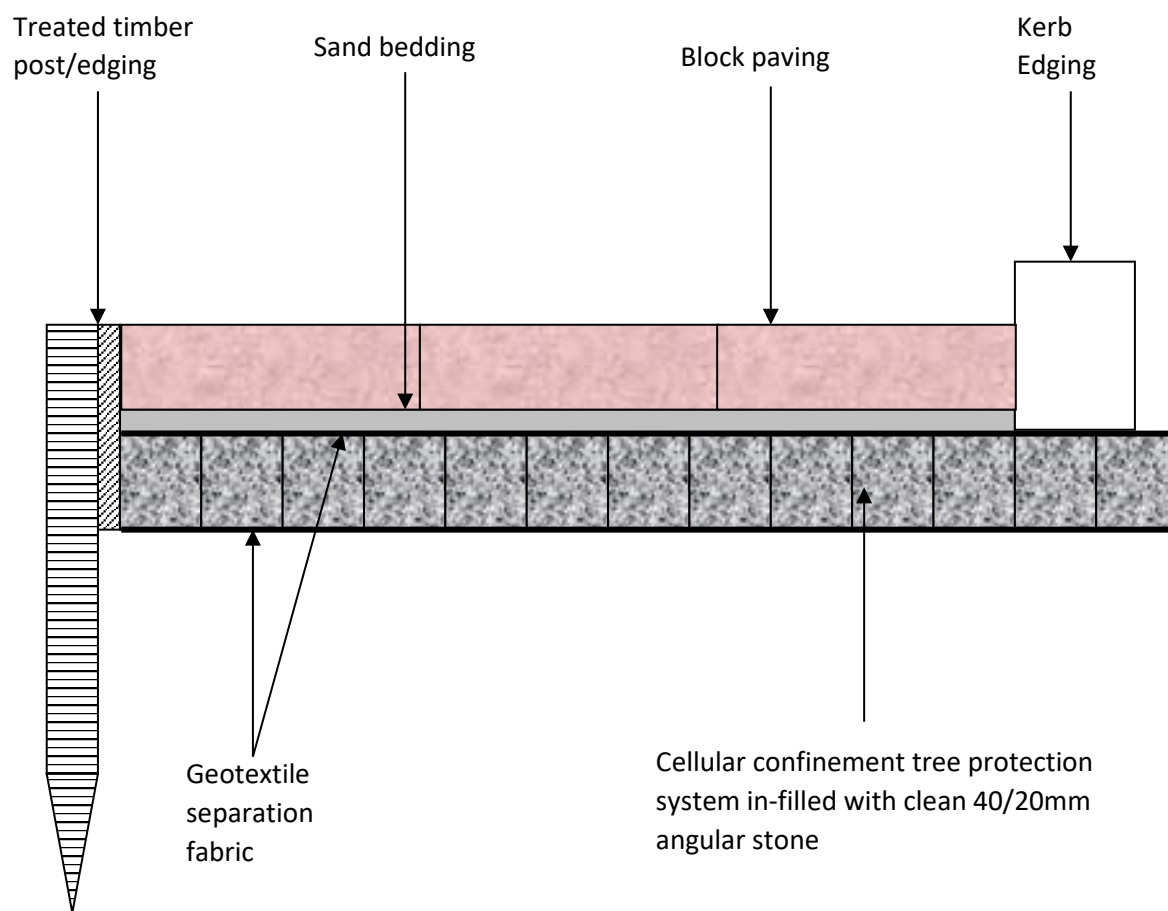

Gravel Surface

