

REPAIRS KEY:

[NBS C41.820A] - item 5 - Type 1
Repoint existing ashlar walling, large open joints repoint with new galleting pieces.


[NBS C41.52A]
Masonry Repair Type 2
New dressed stone Components.

[NBS C41.53A]
Masonry repair Type 3
New dressed stone indents.


[NBS H71.251B] - Lead weatherings dressed over [NBS C41.54A] - Masonry repair Type 4 dress spalled/shattered sills to receive mortar repairs:

[NBS C41.55A]
Masonry repair Type 5
Replace decayed masonry walling.

[NBS R10.380A]
New Rectangular Rainwater Pipe.

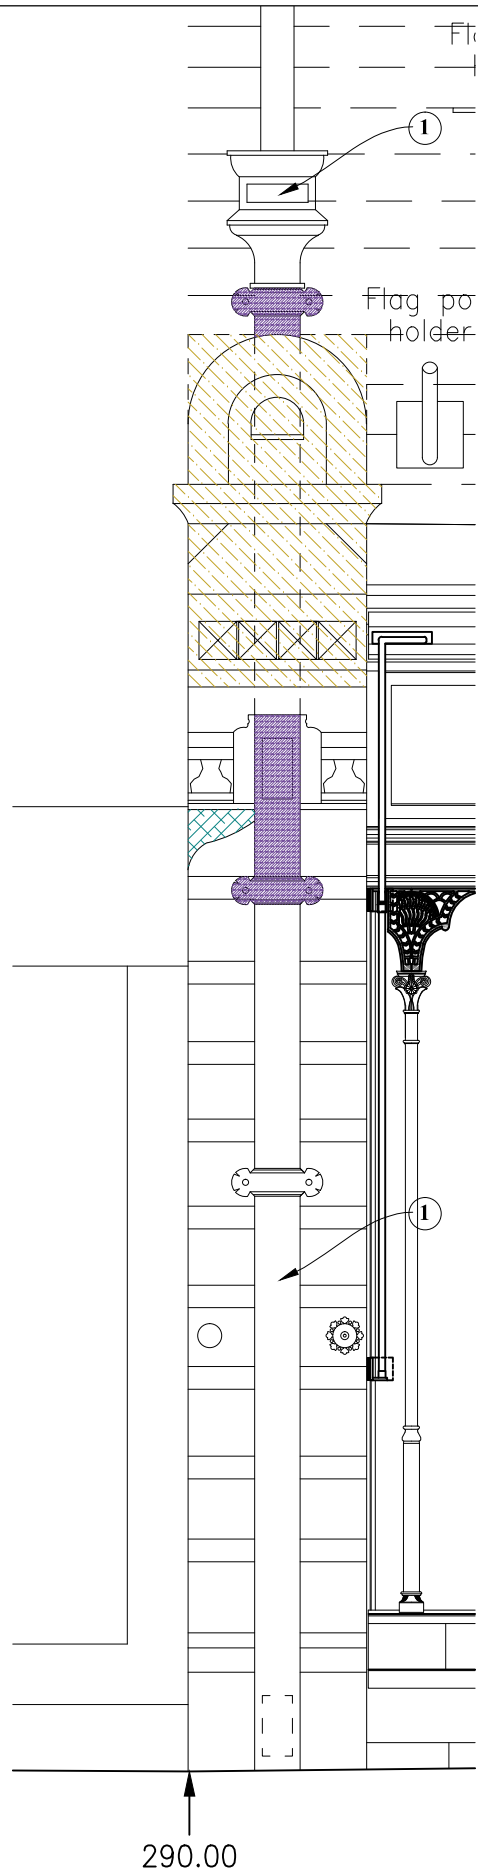


Proposed Masonry Repairs @ LH Pilaster

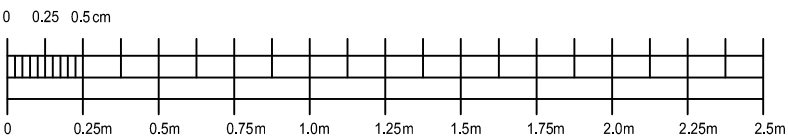

1:25

1 - [NBS C50.10.1] Existing Rectangular rainwater goods (No Works).

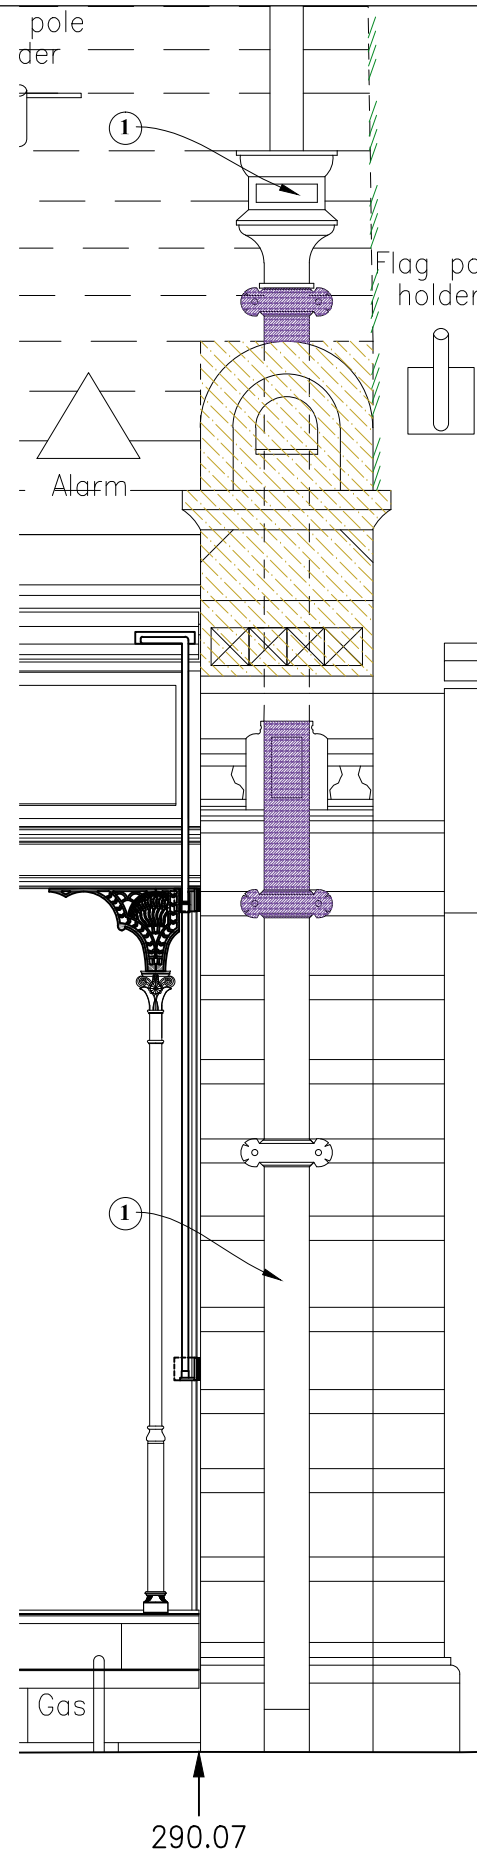

Proposed Masonry Repairs @ RH Pilaster

BENCH
ARCHITECTS

23 TERRACE ROAD
BUXTON
DERBYSHIRE
SK17 6DU
TEL: 01298 23991
info@bencharchitects.co.uk

ARCHITECTURE
HISTORIC BUILDING REPAIR
THE AUTHENTIC INTERIOR

PROJECT:

10-12 Spring Gardens
Fitzgerald Craft Bakery
Buxton
SK17 6DE

CLIENT:

Fitzgerald Craft Bakery Ltd

SUBJECT:

PROPOSED
ELEVATION - MASONRY
REPAIRS - GROUND FLOOR
PILASTERS

CONSTRUCTION ISSUE

DRAWING NO:

22226-P-170 Rev B

DATE:

September 2022

Revisions:

Tender Issue 04.10.22
A: Construction Issue
13.12.22
B: Scale Bar for DOC
05.04.2023

SCALE:

1:25 @ A3

©This drawing and the building works depicted are the copyright of the Architect and may not be reproduced without written permission.