



Install positive pressure ventilation fan to assist with condensation issues. Fan unit located within the roof space. Circular ceiling diffuser fixed to lounge ceiling, position to be confirmed, approx diffuser size 250mm.

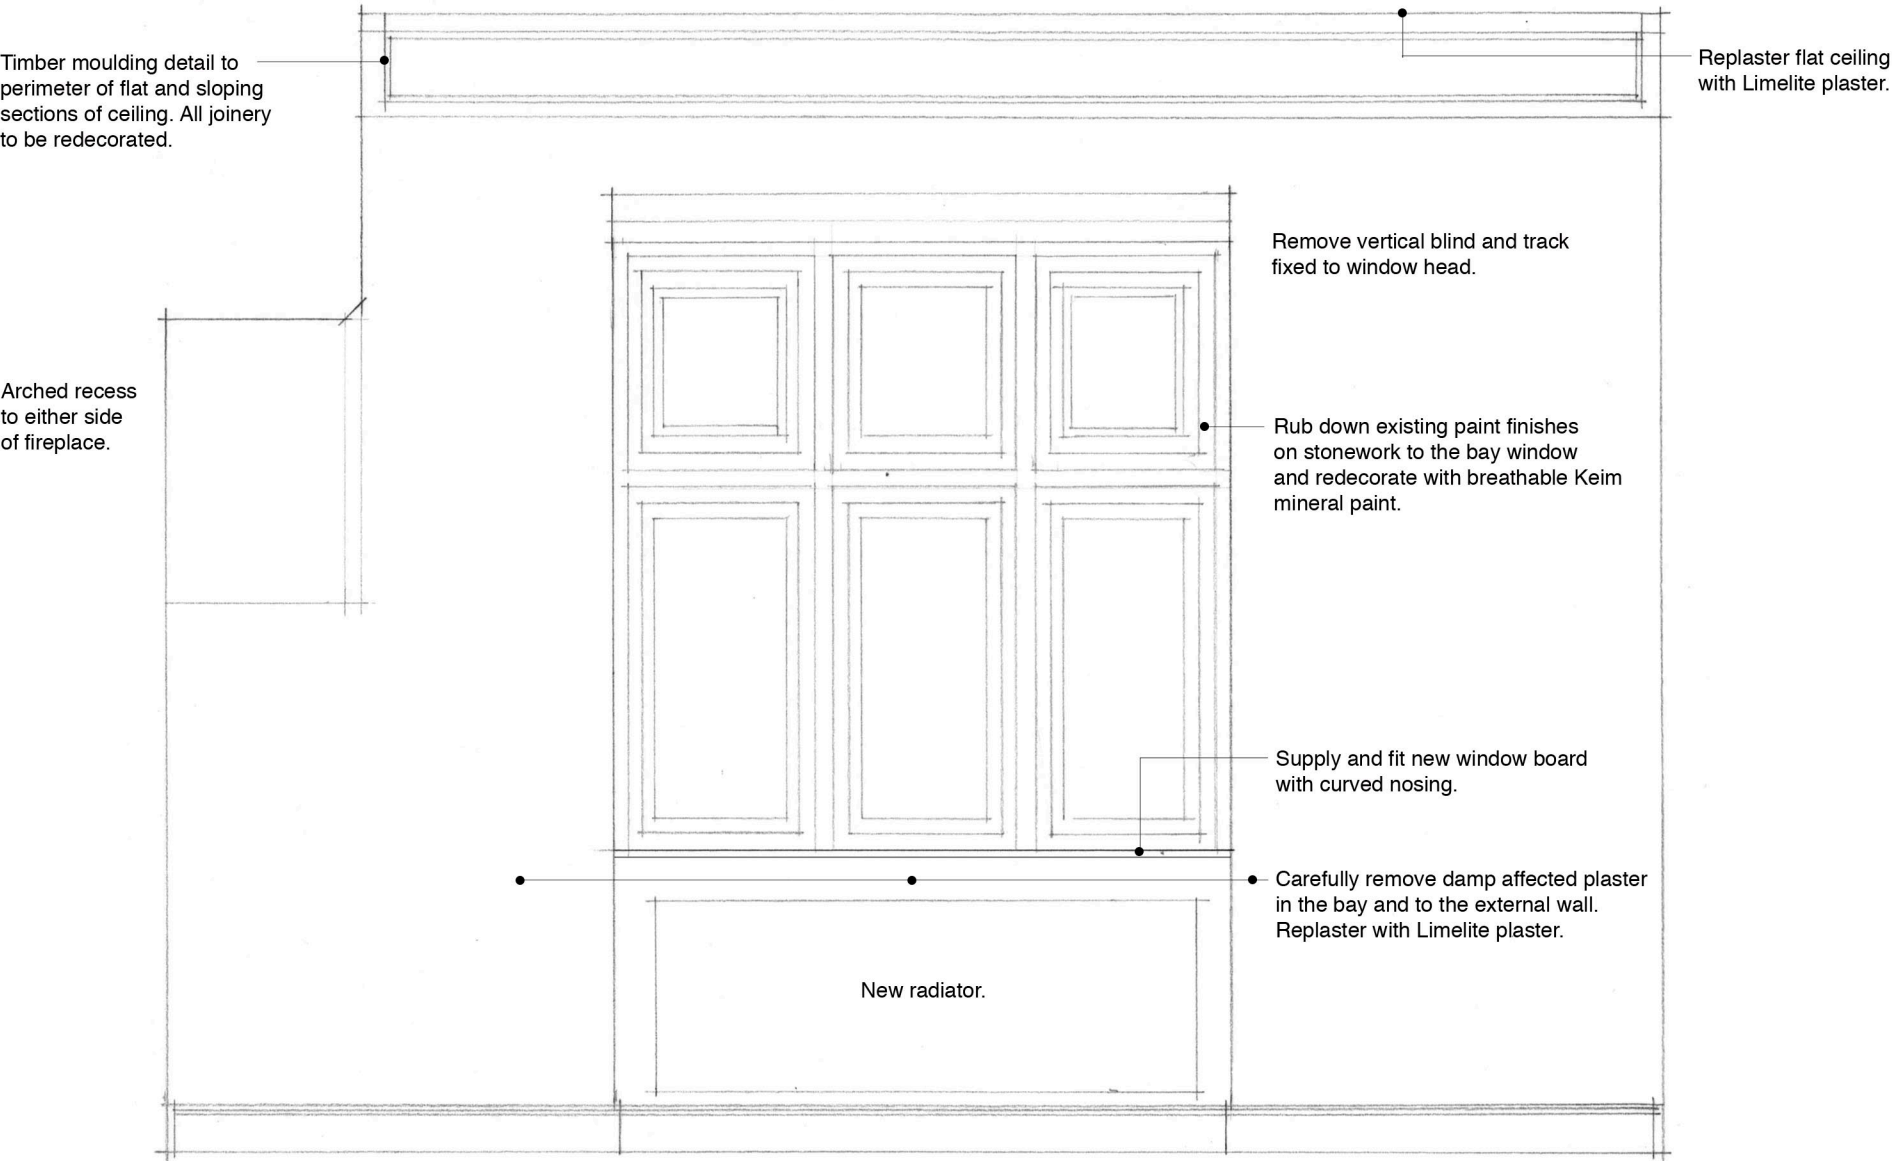

Elevation 19

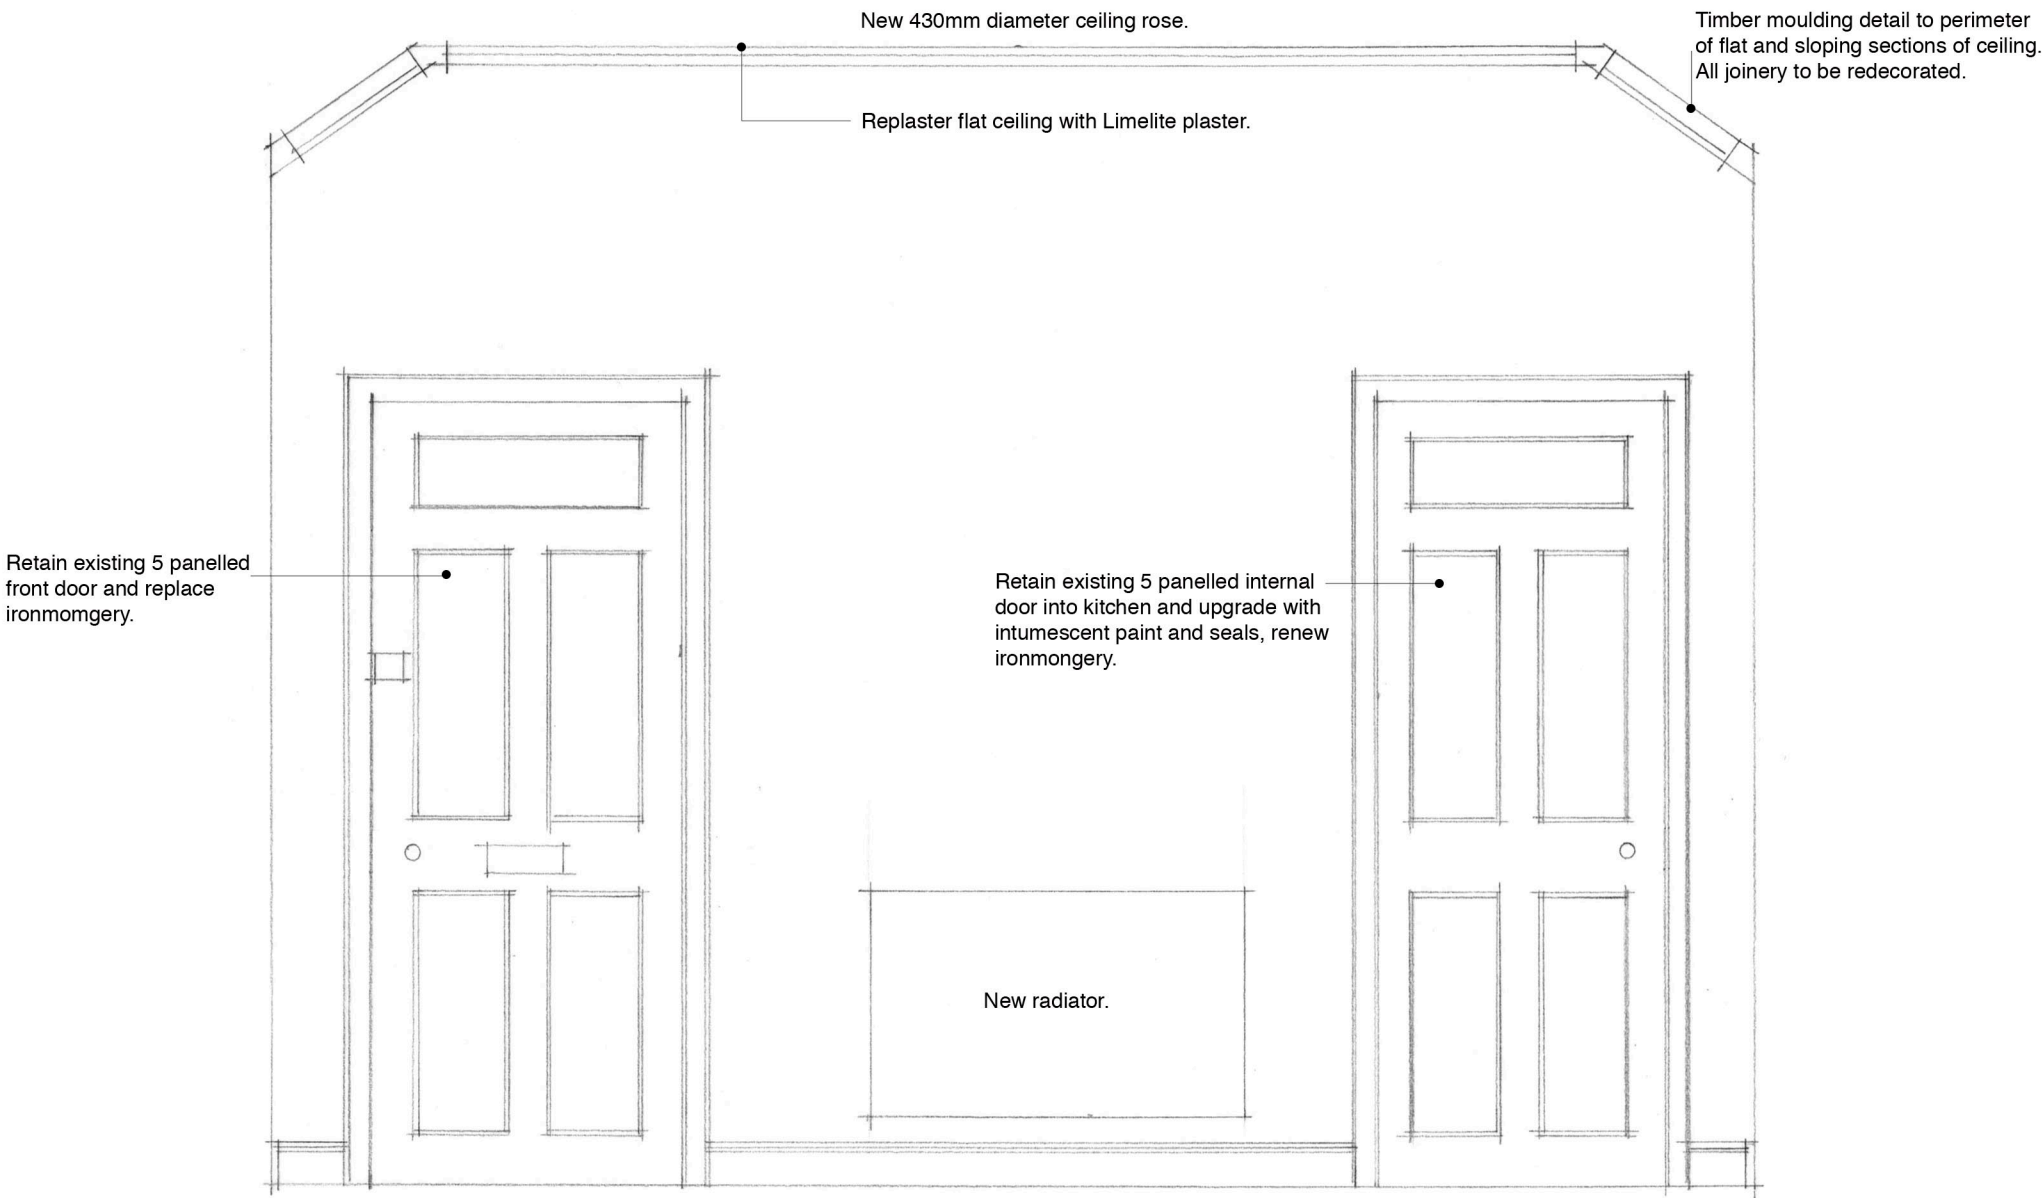

Elevation 20

- Notes:
1. This drawing is to be read in conjunction with proposed layout drawing no's 1906A.11 & 17, and existing layout drawing no's 1906B.01, 06 & 07.
 2. All electrical fittings and wiring to be renewed to current IEE regulations, including consumer unit. Make good any disturbed plaster finishes with Limelite breathable plaster. Remove gas fire and associated pipework.
 3. Lounge to be redecorated. Prior to decoration work remove all surface mould to wall and ceiling finishes. Remove existing wallpaper to walls and ceiling and repair any damaged plaster with Limelite as necessary. Hang new lining paper to receive painted finishes.
 4. Existing skirtings, architraves, frames and door linings to remain.
 5. Resident to provide: window blinds/curtains, electric fire, and carpets.
 6. Supply and fix new Rockwool roof insulation above the Kitchen and Lounge ceilings.

Rev A - Plaster notes updated to reflect Planning discussions. Nov23.

Purpose of issue - Listed Building Consent Issue.

All dimensions to be confirmed on site prior to construction.

Project	Dwg No.
No 2. Ingham's Almshouses, St James' Square, New Mills.	1906B.16A
Drawing Title	Scale
Lounge Elevations 19 & 20 - Proposed.	1:20 @ A3
R. S. Harrington Architect Ltd	Date
m. 07375 399826	June 23.
e. rob@rsharrington.co.uk	