




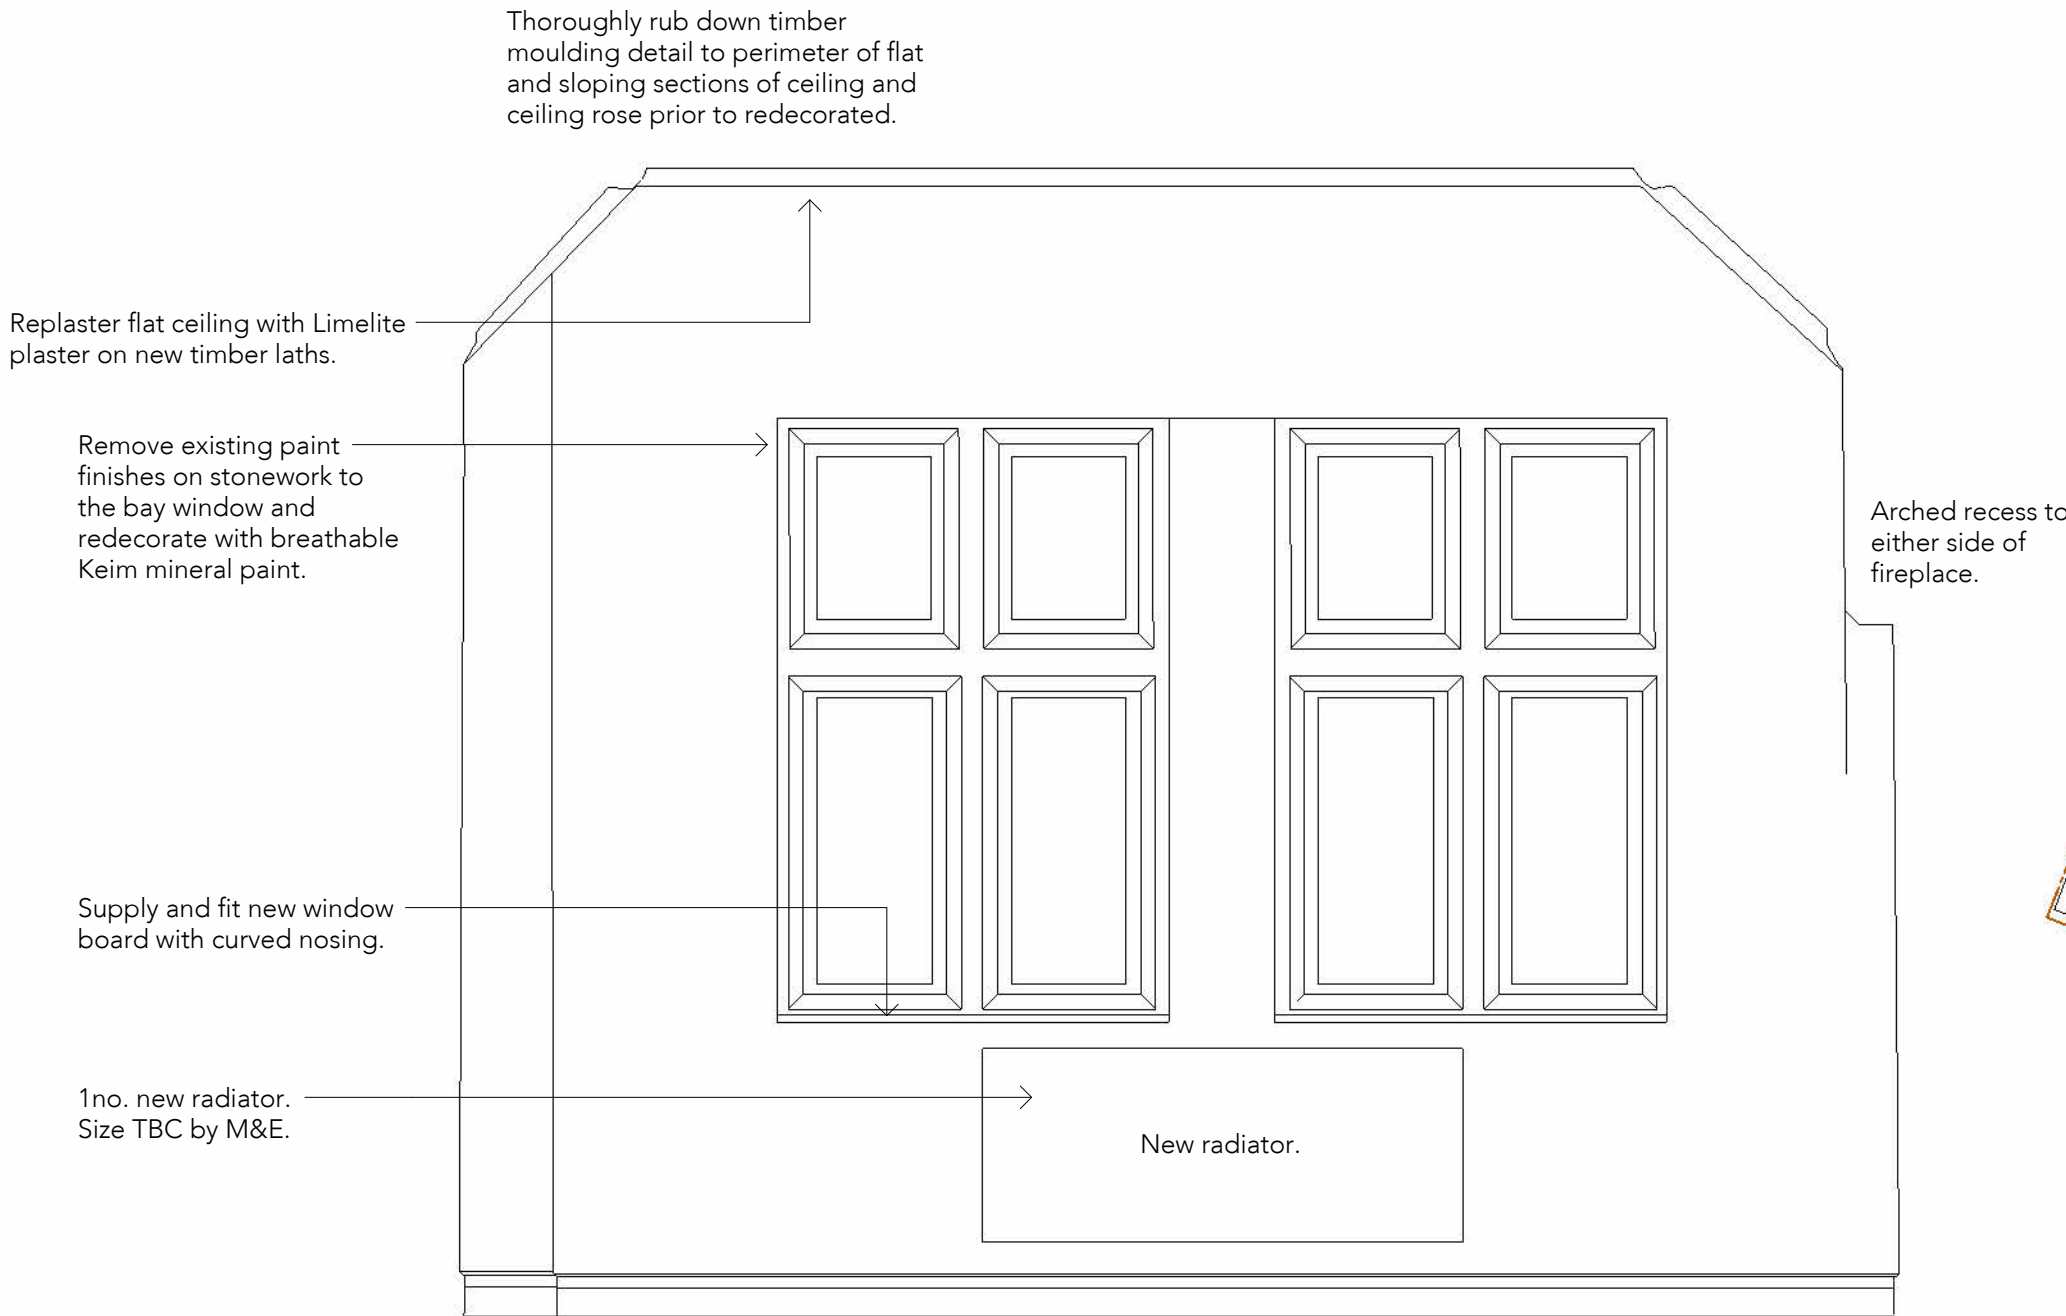


Elevation A
U1-03-A

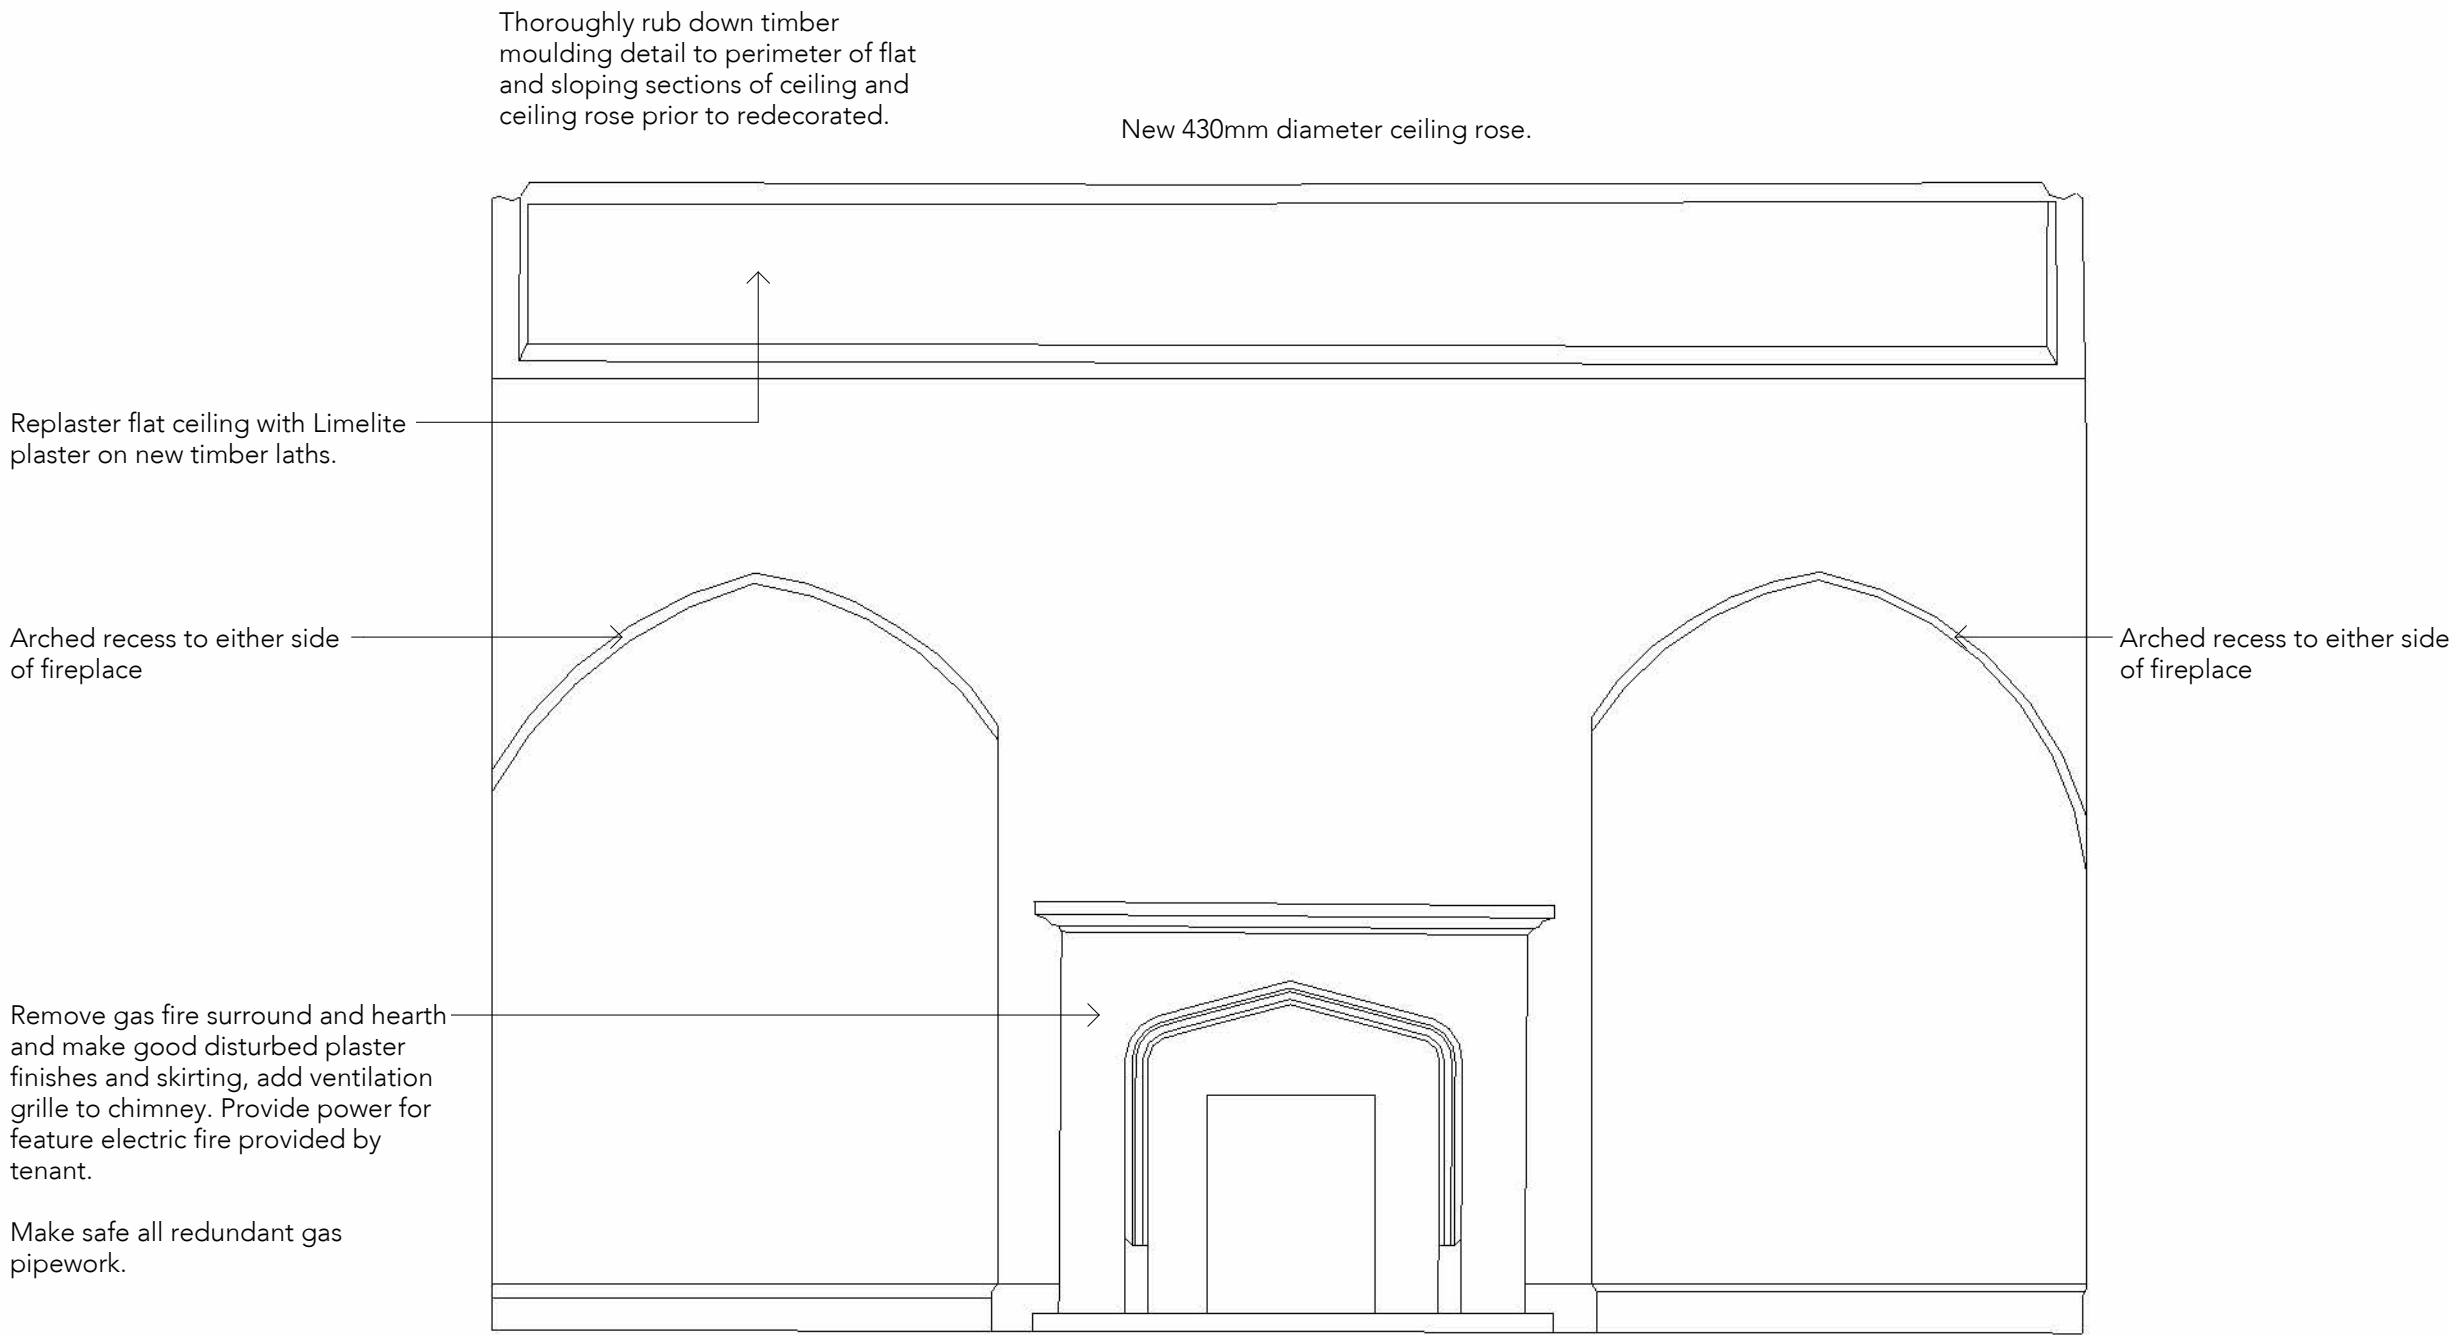

Elevation B
U1-03-B

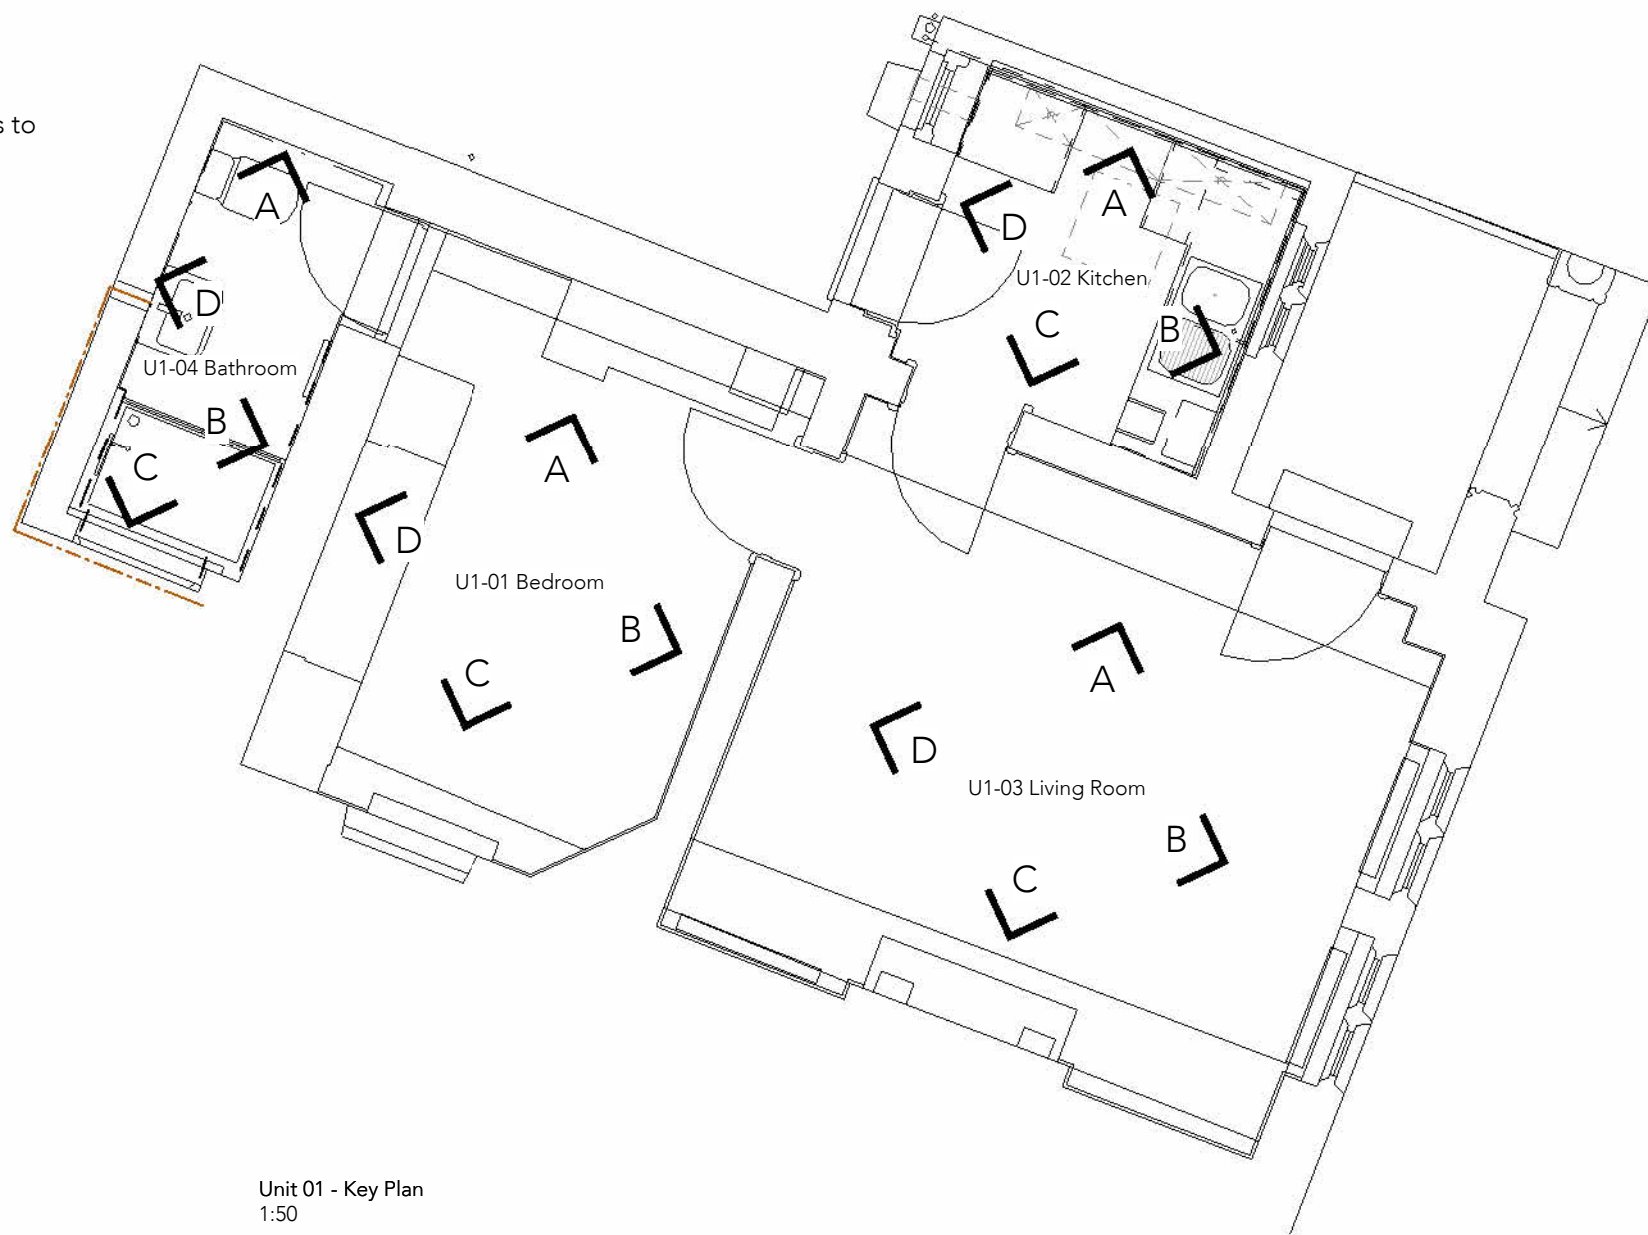

Elevation C
U1-03-C

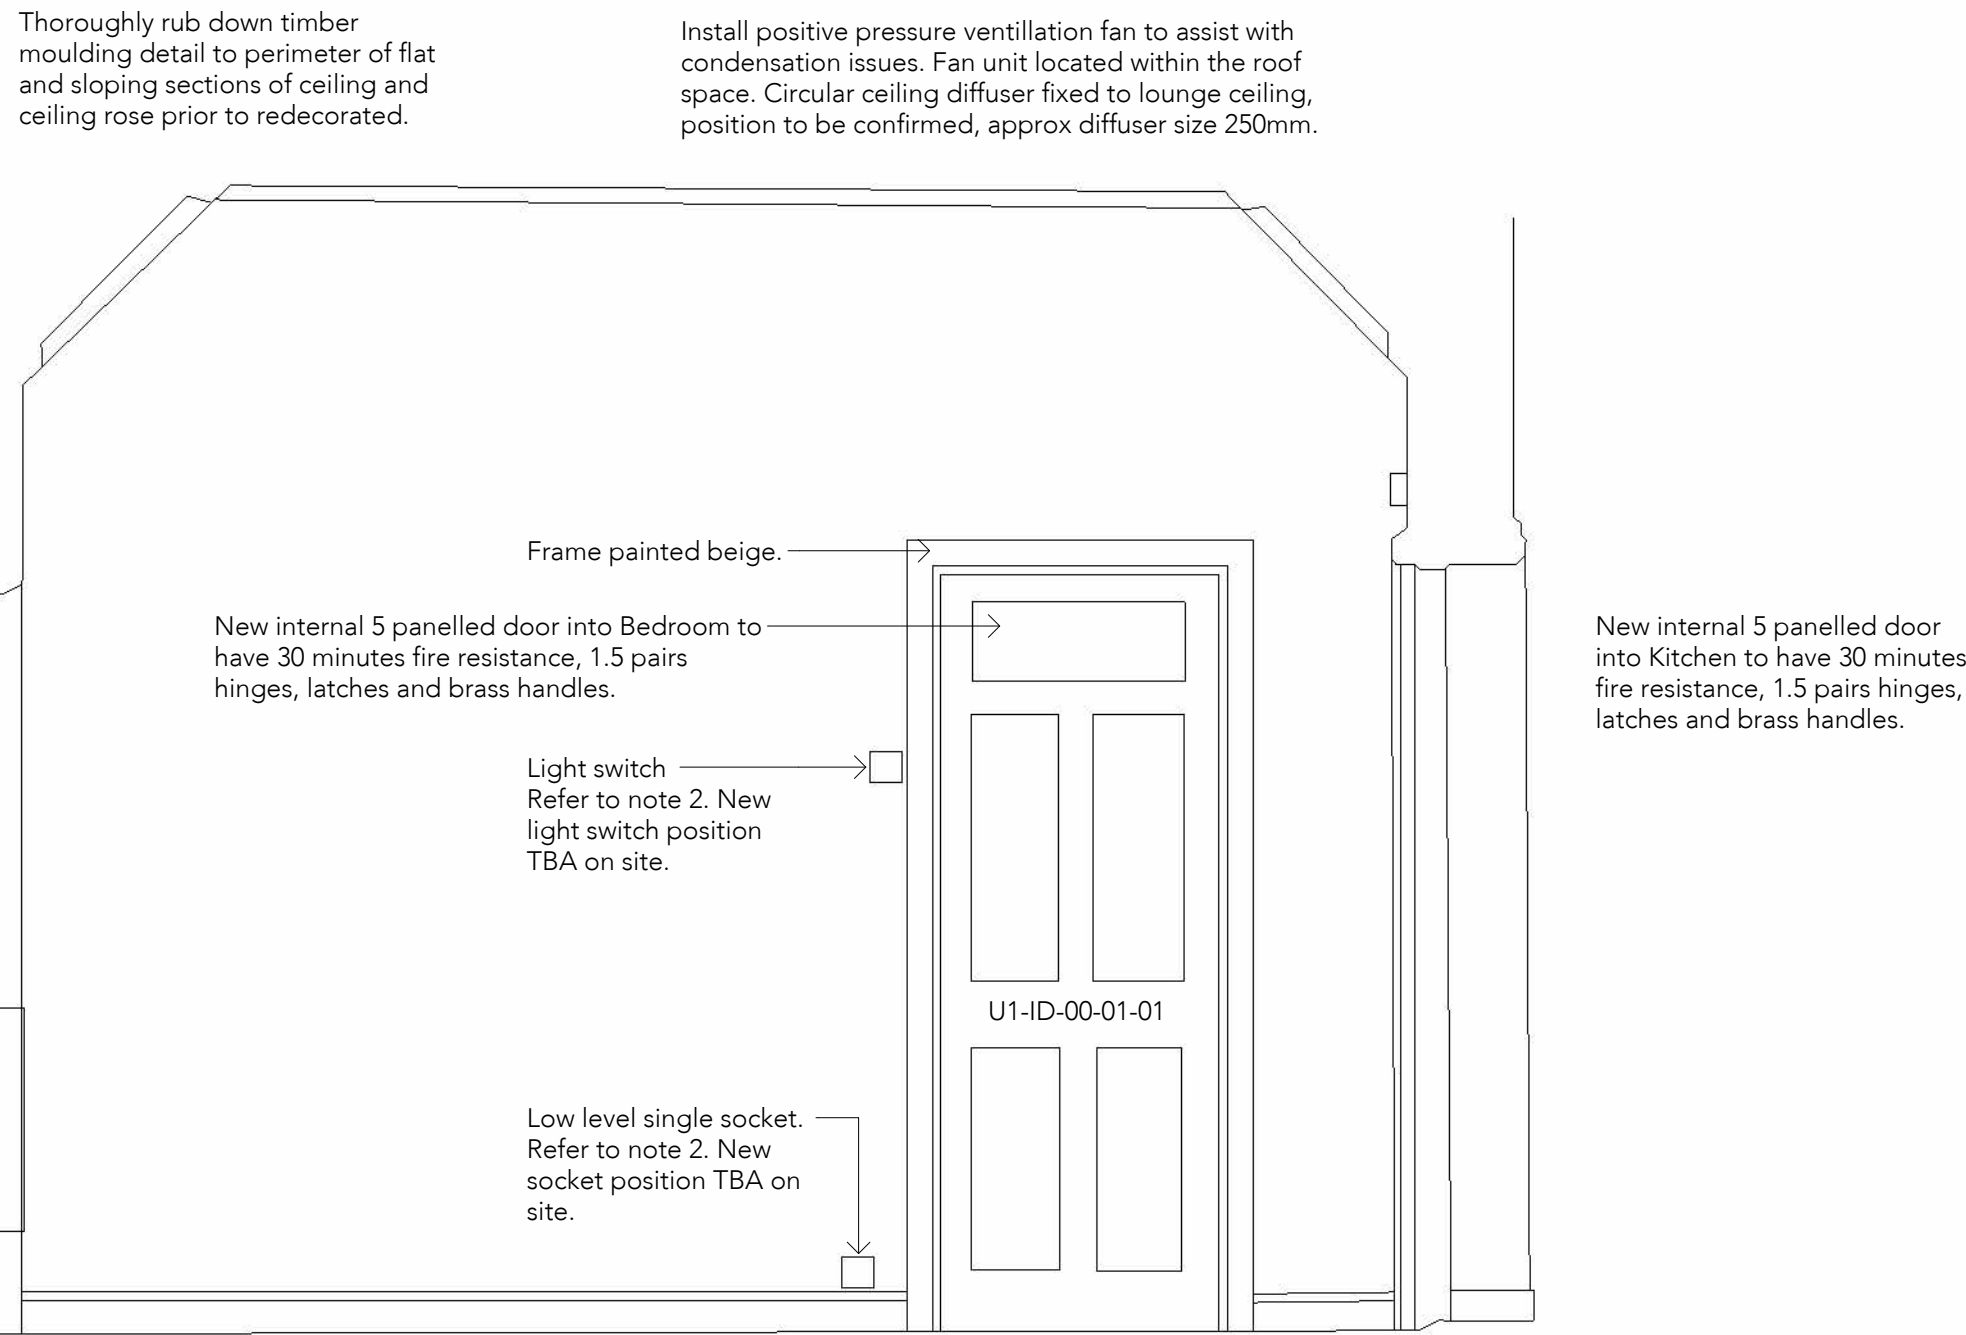

Elevation D
U1-03-D

Notes:
1. This drawing is to be read in conjunction with existing layout drawing no. 01001, and proposed layout drawing no. 02012.

2. Assumed fittings, fixtures and joinery behind obstructed data.

P03	Aug 2024	LB	'Do Not Scale' Omitted
P02	Aug 2024	LB	Submitted
P01	July 2024	LB	For Approval

Rev Date Intls Details

© The moral rights of the author are hereby asserted.
This drawing and design is the sole property of Buttress Ltd and must not be reproduced without permission.
Buttress Ltd is Registered in England and Wales: 536373

Buttress

Manchester
41 Bengal Street
Manchester
M4 6AF
0161 236 3303
www.buttress.net

Leeds
Clockwise, Yorkshire House
Greek Street, Leeds
LS1 5SH
0113 539 7965

Certified
B
Corporation

Project Title Inghams Almshouse
Client Edward Mayes Trust
Location New Mills

Drawing ref Unit 1 - Proposed Internal Room Elevation - Lounge

Date 13/08/2024 14:05:21
Checker LB
Job No: 9848
Scale As indicated
Size A1
Status S3
Suitable for Review and Comments

Project Inghams Almshouse
Origin 13/08/2024 14:05:21
Volume 1
Level 1
Type 1
Role 1
Number 1
Rev 1
INGHM-BUT-XX-XX-DR-A-05012-P03

Unit 1 - Proposed Internal Room Elevations - Lounge

1:20

Notes:
1. Contractor to carry out area of trial ceiling removal (200mm sq) to confirm ceiling material.
2. All electrical fittings and wiring to be renewed to current IEE regulations, including consumer unit. Make good any disturbed plaster finishes with Limelite breathable plaster. Gas supply to Lounge and Kitchen and gas fire to be tested and certified.
3. Lounge to be redecorated. Prior to decoration work remove all surface mould to wall and ceiling finishes. Remove existing wallpaper to walls and ceiling and repair any damaged plaster with Limelite as necessary. Hang new lining paper on existing plastered walls which are then to recieve painted finishes.
4. Existing skirtings, architraves, frames and door linings to remain.
5. Resident to provide: window blinds/ curtains and carpets.
6. Remove of existing floor finishes and dispose of from site.
7. Supply and fix new rockwool roof insulation to the Kitchen and Lounge.
8. Existing carpet to be removed. Replace broken floorboards in matching sizes to the existing. Repair floorboards where required.