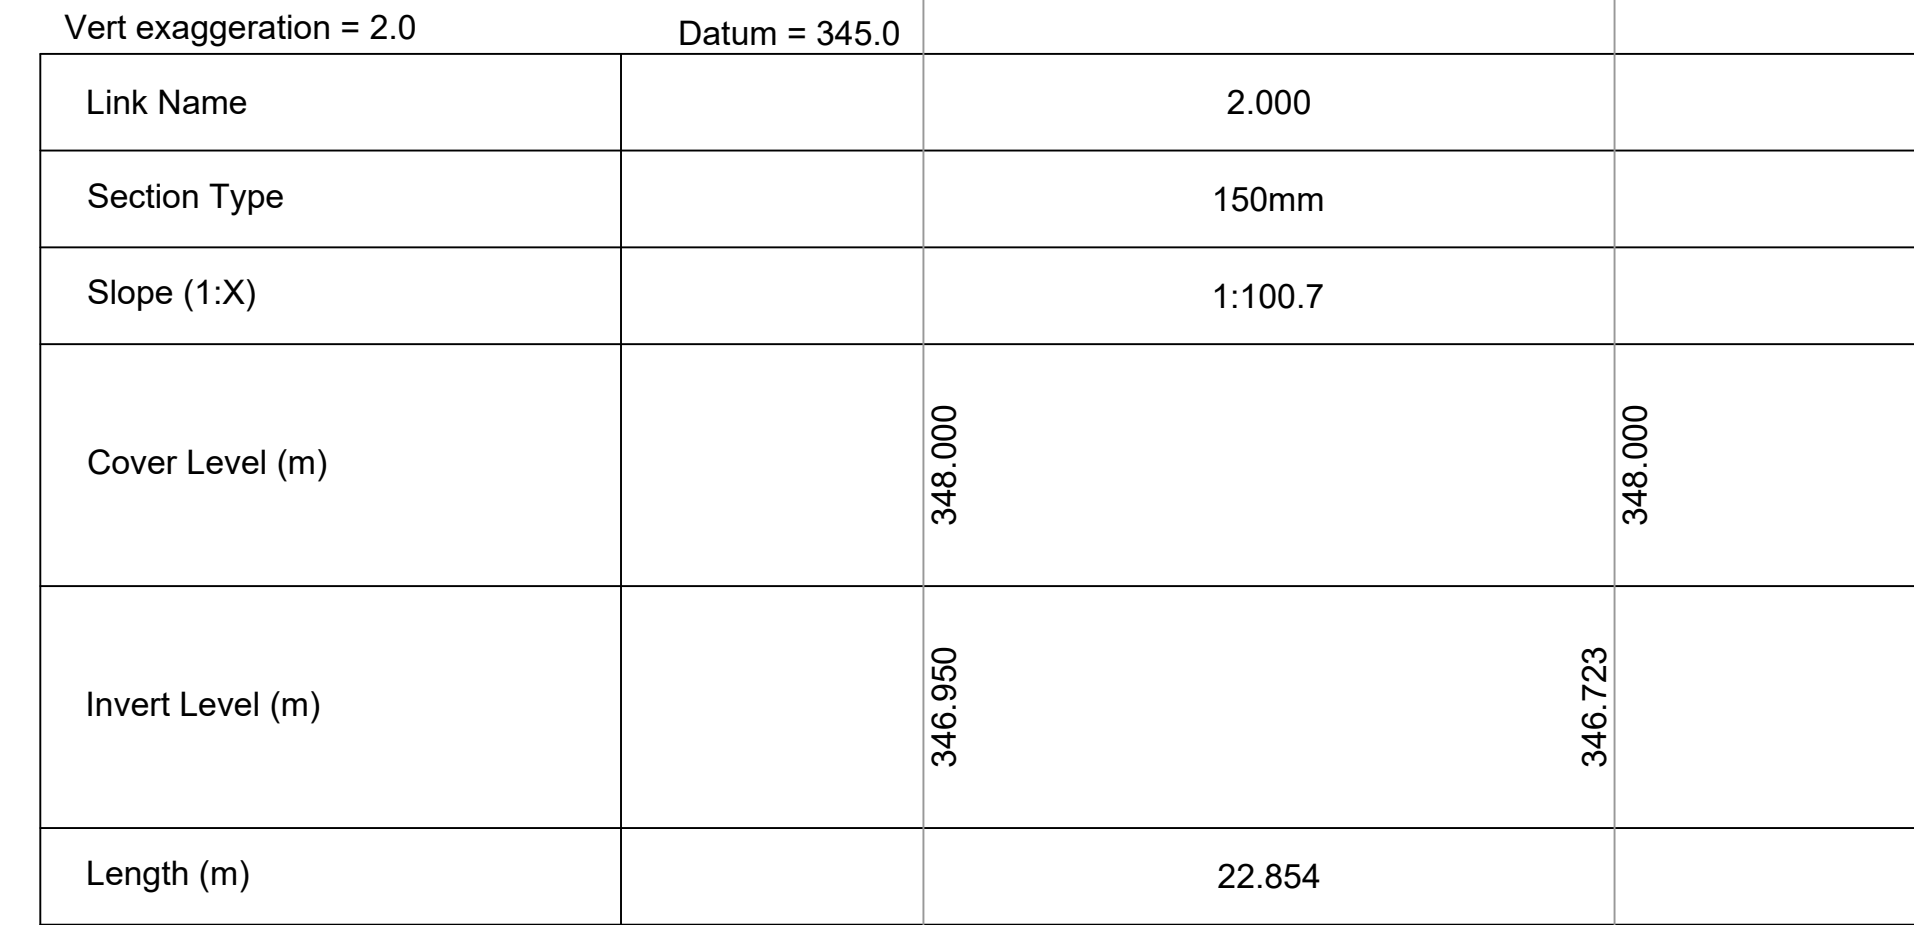
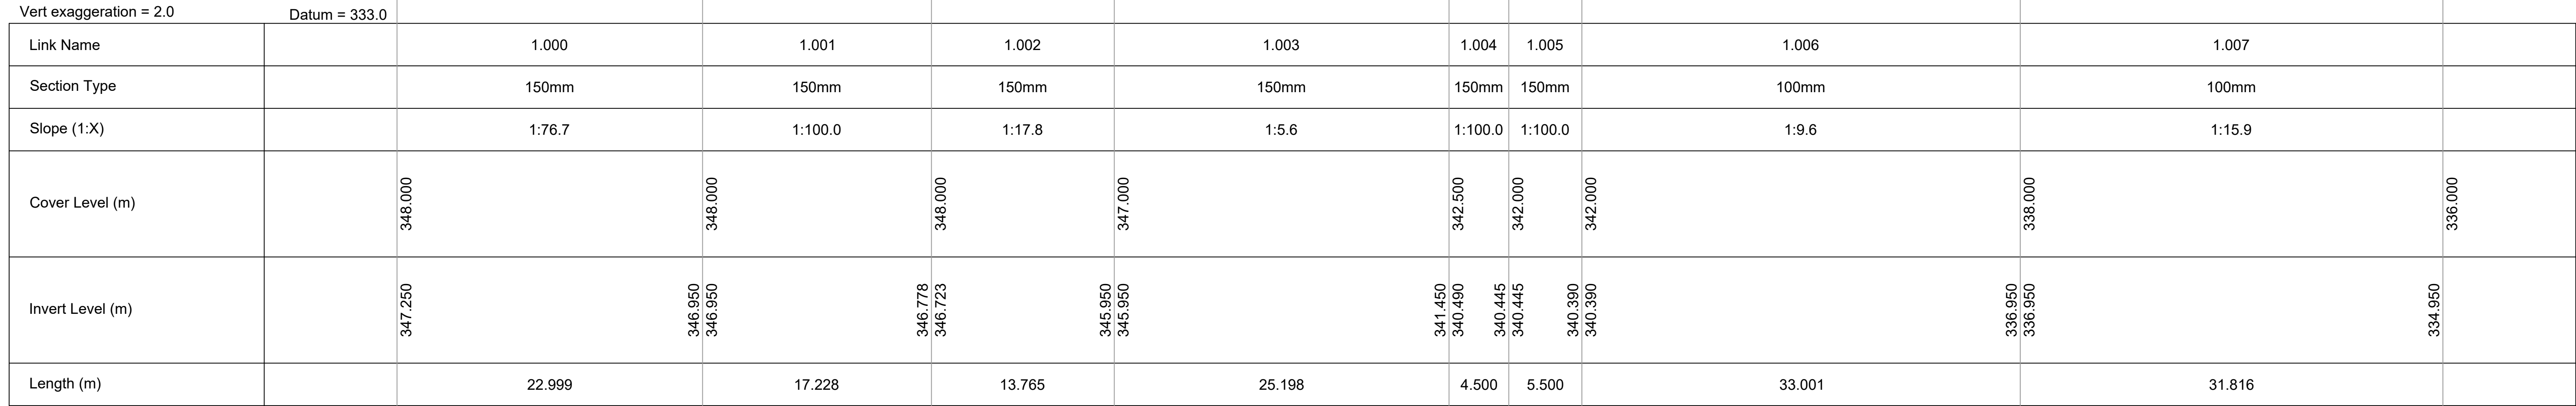
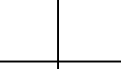


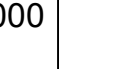
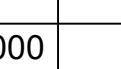
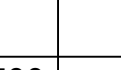


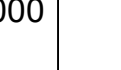
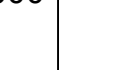
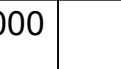



Node ID	Easting (m)	Northing (m)	CL (m)	Depth (m)	Sump (m)	Dia (mm)	Width (mm)	Node Type	Manhole Type	Connections	Link ID	IL (m)	Dia (mm)	Link Type	
S1	-2104.011	-874.135	348.000	0.750		450		Manhole	Plastic Inspection Chamber		0	1.000	347.250	150	Circular
S4	-2087.093	-897.364	348.000	1.277		450		Manhole	Plastic Inspection Chamber		1 2	1.001 2.000	346.778 346.723	150 150	Circular Circular
S2	-2082.028	-880.897	348.000	1.050		450		Manhole	Plastic Inspection Chamber		1	1.000	346.950	150	Circular
S3	-2108.923	-890.601	348.000	1.050		450		Manhole	Plastic Inspection Chamber		0	1.001	346.950	150	Circular
S5	-2074.699	-903.352	347.000	1.050		450		Manhole	Plastic Inspection Chamber		1	1.002	345.950	150	Circular
S6	-2052.503	-915.281	342.500	2.310	0.300	600		Manhole	Plastic Inspection Chamber		1	1.003	341.450	150	Circular
S8	-2016.353	-938.565	338.000	1.050		450		Manhole	Plastic Inspection Chamber		1	1.006	336.950	100	Circular
HW	-1999.855	-965.769	336.000	1.050		150		Manhole	Headwall		1	1.007	334.950	100	Circular
Tank	-2048.735	-917.742	342.000	1.555		150		Junction	Plastic Inspection Chamber		1	1.004	340.445	150	Circular
S7 - Flow Control	-2044.050	-920.623	342.000	1.910	0.300	1200		Manhole	Plastic Inspection Chamber		1	1.005	340.390	150	Circular
											0	1.006	340.390	100	Circular

[illegible]